

General Information

Date & Time: 23, May, 2026 15:37

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	30,853
Registration No.	NFR1435	Chassis No.	MHFAA1BY3R0024661
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



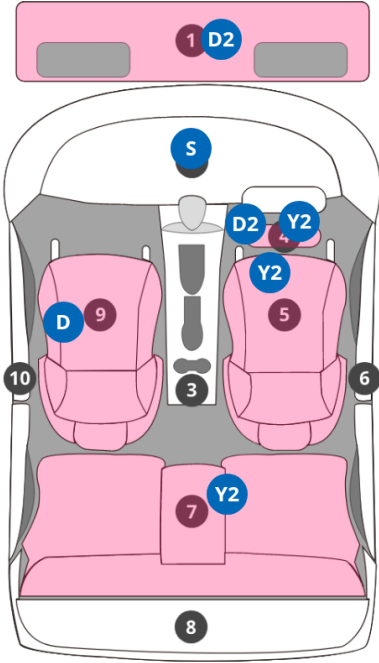
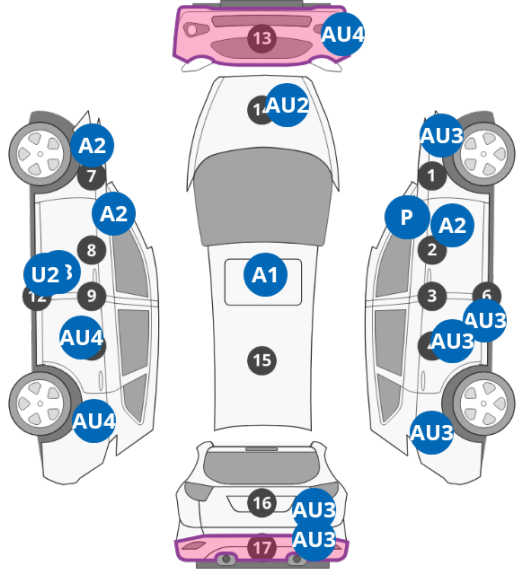
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.3	107	112	106
2	Boot Lid	104.6	104	109	101
3	Roof	117.7	127	125	108/111
4	Left Front Fender	150.0	150	159	141
5	Left Front Door	146.3	136	148	155
6	Center Panel Left				
7	Left Rear Door	204.3	214	185	214
8	Left Back Panel	296.3	297	298	294
9	Right Front Fender	141.3	135	134	155
10	Right Front Door	124.3	127	125	121
11	Center Panel Right				
12	Right Rear Door	120.3	121	122	118
13	Right Back Panel	119.6	117	120	122

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / Ceiling - Crinkle - Small / Overall Interior - Smell - Yes / Rear Seat - Grime - Small	Remarks (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Medium / (R) Mirror - Faded(Color, Gloss) - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Dent - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light