

General Information

Date & Time: 23, May, 2026 15:42

Make	Toyota	Model	Fortuner
YOM	2023	Odo Meter Reading	94,703
Registration No.	NIL3340	Chassis No.	MHFJB8GS8P1590428
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Gray		

Body / Panel Condition



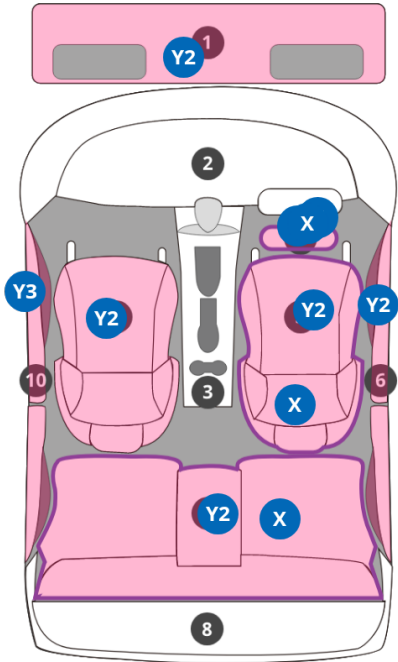
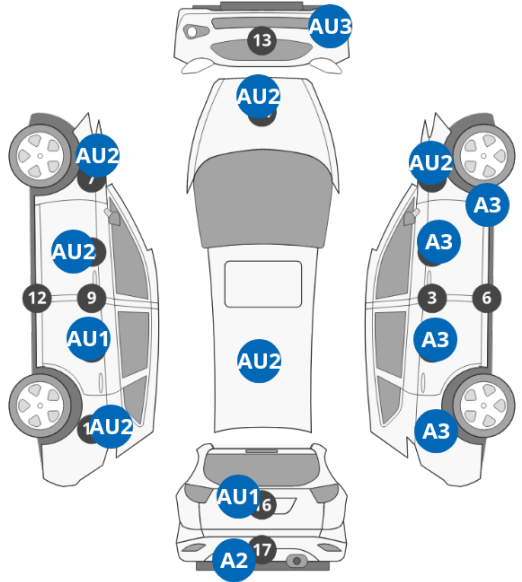
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	132.3	142	122	133
2	Boot Lid	117.6	105	110	138
3	Roof	123.2	109	123	128/133
4	Left Front Fender	123.0	121	116	132
5	Left Front Door	145.0	135	132	168
6	Center Panel Left				
7	Left Rear Door	117.3	120	114	118
8	Left Back Panel	123.3	135	117	118
9	Right Front Fender	121.0	130	115	118
10	Right Front Door	132.6	124	130	144
11	Center Panel Right				
12	Right Rear Door	119.6	120	121	118
13	Right Back Panel	124.3	104	129	140

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Seat Head Rest - Missing - Yes / Rear Seat Head Rest - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Ceiling - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Window (each) - Stuck, Gap - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, with spare tire, no tools and jack, no warranty and manual booklet, no spare key, warning indicator lamp on, reverse light issue, window switch driver side issue, scratches and dent on exterior, scratches on taillight and headlight.