

General Information

Date & Time: 25, May, 2026 07:33

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	41,655
Registration No.	NHH1538	Chassis No.	PA1B18F36SP4233569
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



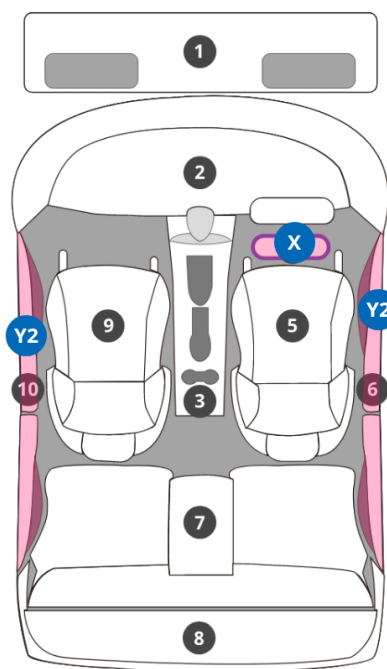
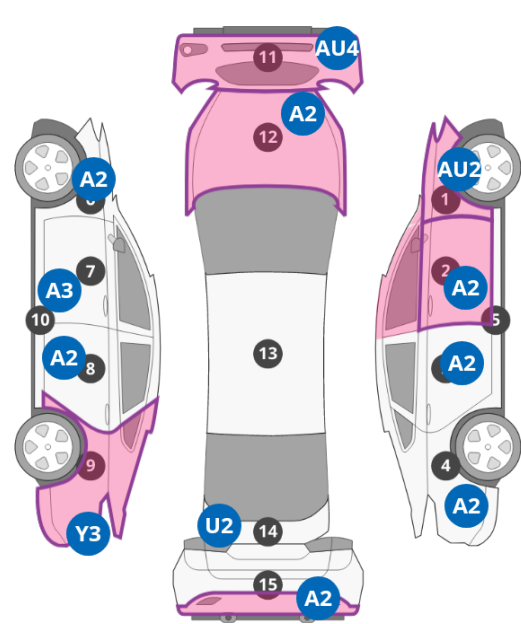
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.3	103	101	109
2	Boot Lid	109.0	107	105	115
3	Roof	97.6	107	95	90/99
4	Left Front Fender	98.0	97	98	100
5	Left Front Door	103.0	105	103	101
6	Center Panel Left				
7	Left Rear Door	104.6	104	102	108
8	Left Back Panel	238.6	387	160	169
9	Right Front Fender	183.0	118	290	141
10	Right Front Door	109.0	104	111	112
11	Center Panel Right				
12	Right Rear Door	104.0	103	103	106
13	Right Back Panel	114.0	110	104	128

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / Bonnet, Headlight - Repair mark - Difference in Color / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Crack, Gap - Medium / Trunk Hood, Rear Gate - Dent - Small
Frame Evaluation : D	Functional Evaluation : C
Remarks Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes	Remarks Air Conditioner - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

no jack and tools/ no warranty booklet/ air-conditioning issue/ traction control light on /light scratches around the exterior/ no back trunk cover/ with spare tire and LTO plate