

## General Information

Date & Time: 01, Jun, 2026 10:28

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Hiace             |
| YOM              | 2023    | Odo Meter Reading | 51,989            |
| Registration No. | NIP4601 | Chassis No.       | JTFJT02P4P5034887 |
| CC               | 3.0     | Transmission      | M/T               |
| Fuel Type        | Diesel  | Type of Body      | Van               |
| Colour           | White   |                   |                   |

## Body / Panel Condition



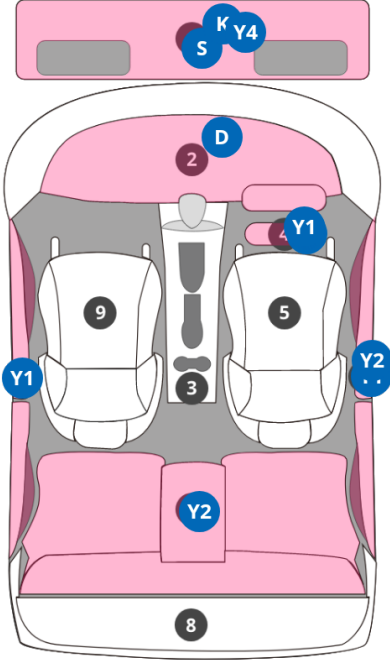
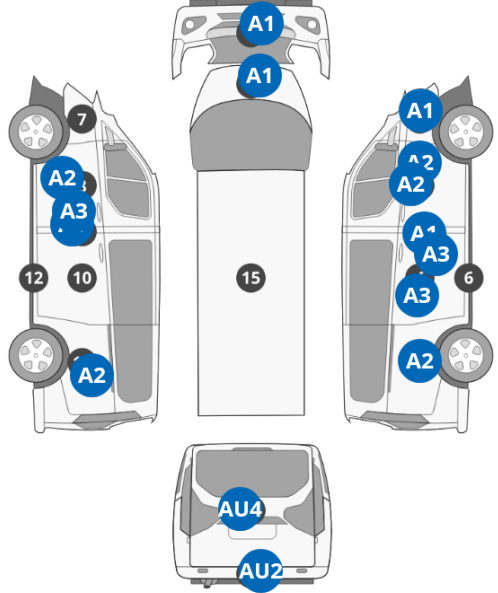
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 77.7          | 76     | 78     | 80       |
| 2  | Boot Lid           | 84.8          | 86     | 87     | 82       |
| 3  | Roof               | 87.9          | 109    | 78     | 84/81    |
| 4  | Left Front Fender  | 88.3          | 87     | 92     | 86       |
| 5  | Left Front Door    | 70.9          | 73     | 73     | 68       |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     |               |        |        |          |
| 8  | Left Back Panel    | 96.4          | 80     | 73     | 136      |
| 9  | Right Front Fender | 94.4          | 93     | 94     | 96       |
| 10 | Right Front Door   | 72.0          | 73     | 71     | 73       |
| 11 | Center Panel Right | 68.8          | 66     | 69     | 71       |
| 12 | Right Rear Door    | 70.8          | 69     | 71     | 73       |
| 13 | Right Back Panel   | 82.2          | 79     | 84     | 84       |

## Overall Evaluation :

C

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <b>C</b>                                                                                                                                                                                                                                                                                                                                                                                       | Exterior Evaluation : <b>D</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                                                                                                                                                                   |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                              |
| <p><b>Remarks</b></p> <p>Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / Ceiling - Grime - Large / (L) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Rear Trim - Grime - Small / Rear Seat - Grime - Small / Mat Other - Grime - Small / (R) Front Floor Mat - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes</p> | <p><b>Remarks</b></p> <p>Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Center Panel - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch &amp; Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch - Medium</p> |
| Frame Evaluation : <b>A</b>                                                                                                                                                                                                                                                                                                                                                                                          | Functional Evaluation : <b>A</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
| <p><b>Remarks</b></p> <p>Defects not found</p>                                                                                                                                                                                                                                                                                                                                                                       | <p><b>Remarks</b></p> <p>Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |

| Inspector Notes                                                                                                                  |
|----------------------------------------------------------------------------------------------------------------------------------|
| <p>Paint marks at exterior. Incomplete tools. Without warranty booklet. With sparetire, seatcover, jack, LTO PLate and 1key.</p> |