

General Information

Date & Time: 02, Jun, 2026 08:36

Make	Suzuki	Model	Carry
YOM	2022	Odo Meter Reading	84,350
Registration No.	GAP2742	Chassis No.	MHYHDC61TMJ916398
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	FB Body
Colour	White		

Body / Panel Condition



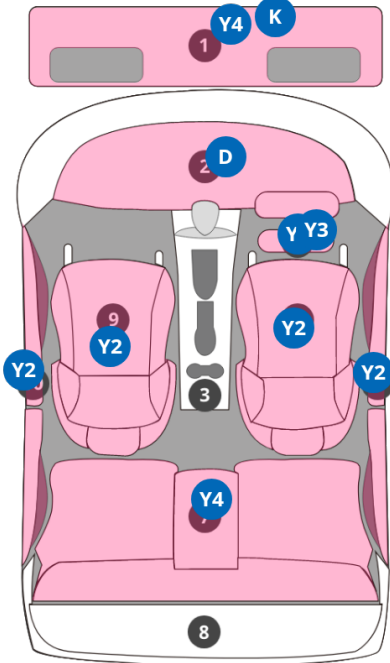
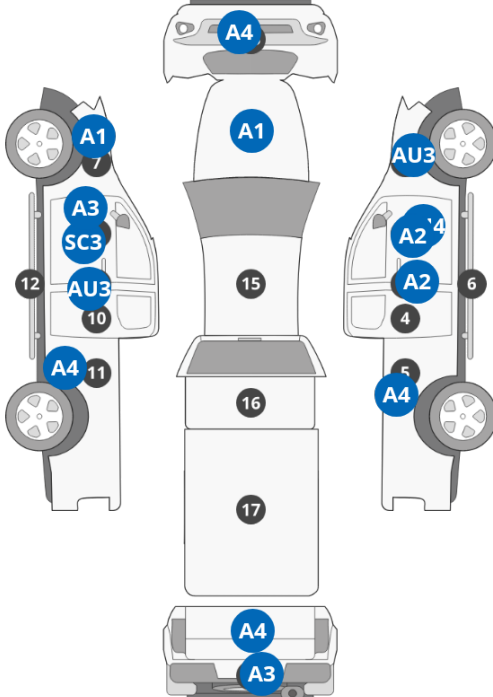
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	273.6	191	399	231
2	Boot Lid	130.0	105	137	148
3	Roof	103.7	112	106	98/99
4	Left Front Fender	320.3	228	239	494
5	Left Front Door	106.0	108	112	98
6	Center Panel Left	114.6	99	123	122
7	Left Rear Door				
8	Left Back Panel	159.3	163	155	160
9	Right Front Fender	122.3	118	125	124
10	Right Front Door	112.0	108	116	112
11	Center Panel Right	103.6	91	107	113
12	Right Rear Door				
13	Right Back Panel	132.0	116	148	132

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / Rear Seat - Grime - Large / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Overall Interior - Animal Hair - Yes	Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Center Panel - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Rust, Corrosion - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Center Panel - Scratch - Small / (R) Side Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Rear Gate - Scratch - Large / (L) Side Gate - Scratch - Large
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Possible flooded. Without tools and jack. With sparetire, seatcover, warranty booklet, LTO plate and 2keys.