

General Information

Date & Time: 21, Feb, 2025 14:53

Make	Toyota	Model	Raize
YOM	2024	Mileage	36,779
Registration No.	NIQ2461	Chassis No.	MHKAB1BA8PJ061486
CC	1.2	Transmission	M/T
Fuel Type	Gas	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



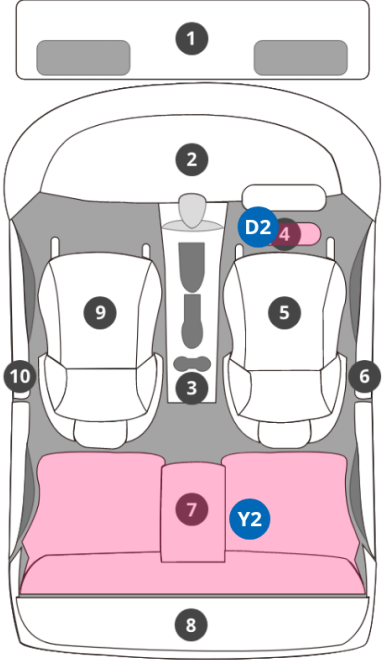
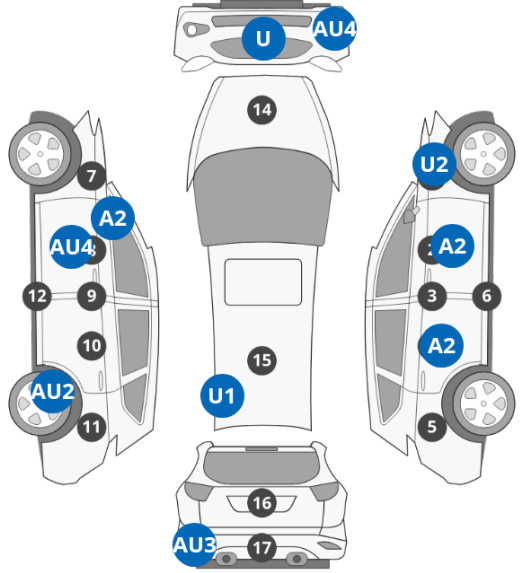
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.9	97	109	112
2	Boot Lid	78.0	78	77	79
3	Roof	99.5	99	97	115/87
4	Left Front Fender	83.4	81	89	81
5	Left Front Door	95.7	100	97	91
6	Center Panel Left				
7	Left Rear Door	92.5	96	92	89
8	Left Back Panel	79.3	75	77	87
9	Right Front Fender	75.6	78	78	72
10	Right Front Door	85.2	85	84	87
11	Center Panel Right				
12	Right Rear Door	77.7	76	79	78
13	Right Back Panel	69.0	73	68	66

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks Member (Bolted) - Dent - Yes / (L) Front Door, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (R) Front Fender, Molding - Dent - Small / (R) Front Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / Roof - Dent - Minimal
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes

Inspector Notes
without warranty booklet. with Spare tire and jack but incomplete tools. with LTO plate. Gap at the right front bumper and at the left rear bumper.