

General Information

Date & Time: 11, Jun, 2026 22:24

Make	Toyota	Model	Lite Ace
YOM	2023	Odo Meter Reading	1,234
Registration No.	FAN9186	Chassis No.	MHKU3FE10NK001398
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Pickup
Colour	White		

Body / Panel Condition



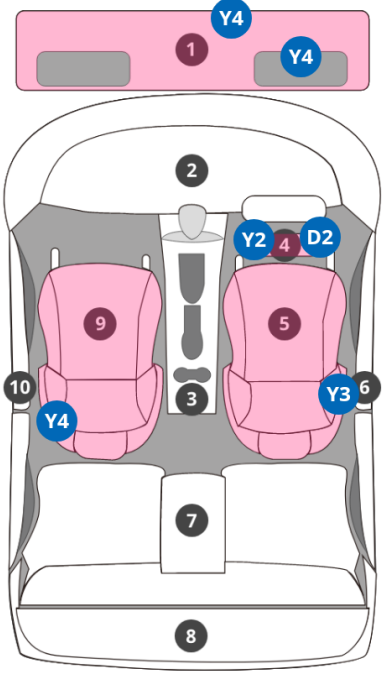
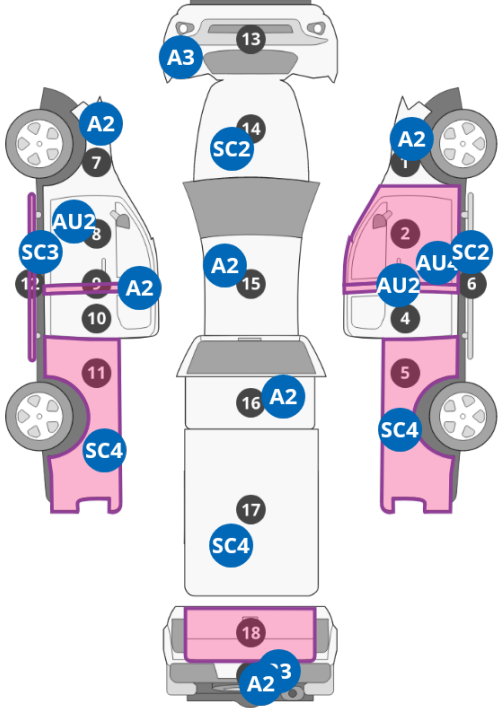
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	51.6	60	44	51
2	Boot Lid				
3	Roof	40.3	37	41	41/42
4	Left Front Fender	36.7	36	36	39
5	Left Front Door	45.6	45	48	44
6	Center Panel Left	51.4	57	46	52
7	Left Rear Door				
8	Left Back Panel	72.3	37	91	89
9	Right Front Fender	51.5	58	48	49
10	Right Front Door	153.7	45	41	375
11	Center Panel Right	53.9	41	63	58
12	Right Rear Door				
13	Right Back Panel	43.6	43	51	37

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / Sunvisor, Sunglass Holder - Grime - Large / (L) Front Seat - Grime - Large / (R) Front Seat - Grime - Medium / Carpet - Loose, Deformed - Small / (R) Front Floor Mat - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Step, In-panel, Side Spoiler - Rust, Corrosion - Medium / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Center Panel - Repair mark - Yes / (L) Front Door, Molding - Scratch & Dent - Small / (L) Center Panel - Scratch - Small / (L) Side Gate - Repair mark - Yes / (L) Side Gate - Rust, Corrosion - Large / Rear Bumper, Lamps, Panels - Modified - Medium / Rear Gate - Partially Missing - Yes / Cargo Bed Floor - Rust, Corrosion - Large / (R) Side Gate - Repair mark - Yes / (R) Side Gate - Rust, Corrosion - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Panel - Rust, Corrosion - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Small / (R) Step, In-panel, Side Spoiler - Rust, Corrosion - Small / (R) Center Panel - Repair mark - Yes / (R) Center Panel - Scratch & Dent - Small / Cab Back Panel - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : B	Functional Evaluation : E
Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes	Remarks Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Power Steering - Issue - Yes / Air Conditioner - Function - Weak / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes

Inspector Notes
non- moving unit, mileage and functional cannot be determine due to non-moving vehicle, with warranty booklet and LTO plate number, with spare tire, no tools with jack, tail light issue, rear gate issue/