

General Information

Date & Time: 13, Jul, 2026 10:38

Make	Toyota	Model	Hiace
YOM	2023	Odo Meter Reading	53,596
Registration No.	NHI7565	Chassis No.	JTFJT02P8P0016826
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



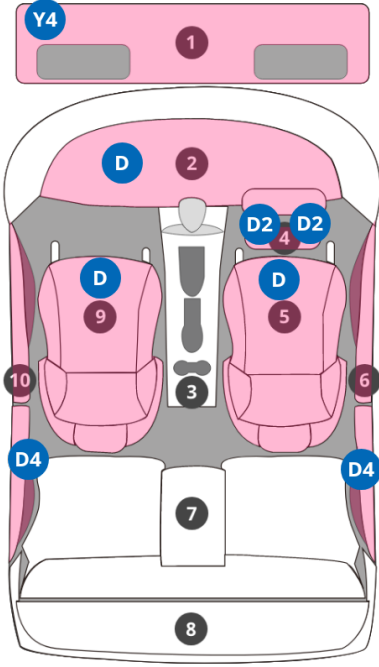
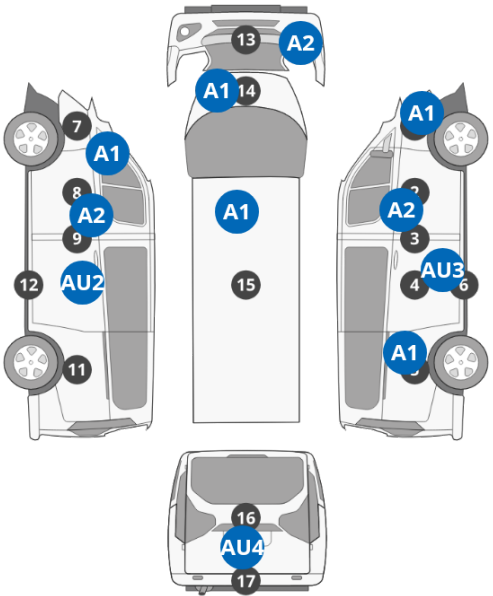
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	76.2	75	77	77
2	Boot Lid	64.2	60	64	69
3	Roof	73.1	72	69	91/61
4	Left Front Fender	82.5	82	81	85
5	Left Front Door	73.6	74	74	73
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	69.3	71	69	69
9	Right Front Fender	78.5	76	73	87
10	Right Front Door	71.7	72	78	65
11	Center Panel Right	71.8	77	69	70
12	Right Rear Door	74.4	75	73	75
13	Right Back Panel	73.9	74	72	76

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / Overall Interior - Worn as per age - Yes / Dashboard - Traces of Adhesive Tape - Yes / (L) Rear Trim - Worked - Large / (R) Rear Trim - Worked - Large / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small	Remarks (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Front Panel - Scratch - Minimal / Overall Exterior - Faded(Color, Gloss) - Yes / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with Ito plate/with warranty booklet/with hairlines scratches on the body/without spare key/with spare tire/without tools/engine won't start/functional can't verify due to engine won't start