

General Information

Date & Time: 03, Jun, 2026 15:47

Make	Suzuki	Model	Carry
YOM	2022	Odo Meter Reading	89,865
Registration No.	KAF7436	Chassis No.	MHYHDC61TMJ916421
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Utility Vehicle
Colour	White		

Body / Panel Condition



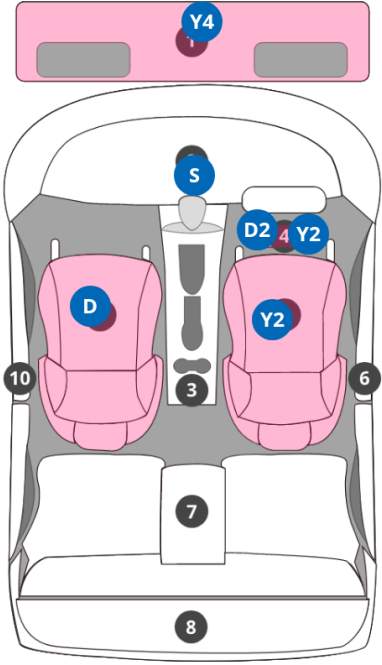
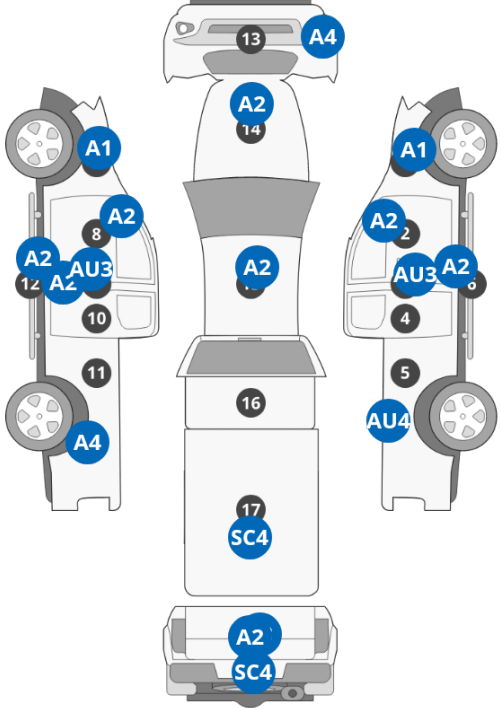
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.6	127	108	118
2	Boot Lid	127.0	110	141	130
3	Roof	96.4	105	99	92/90
4	Left Front Fender	120.3	125	113	123
5	Left Front Door	104.0	108	104	100
6	Center Panel Left	105.9	117	110	91
7	Left Rear Door				
8	Left Back Panel	119.6	95	139	125
9	Right Front Fender	117.6	121	119	113
10	Right Front Door	109.3	109	115	104
11	Center Panel Right	104.8	105	117	93
12	Right Rear Door				
13	Right Back Panel	117.4	88	122	142

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / Overall Interior - Smell - Yes	Remarks Rear Gate - Modified - Medium / Cargo Bed Floor - Rust, Corrosion - Large / Rear Bumper, Lamps, Panels - Rust, Corrosion - Large / (L) Side Gate - Scratch - Large / (L) Center Panel - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Panel - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Side Gate - Scratch & Dent - Large / Rear Gate - Scratch - Small / Roof - Scratch - Small / (R) Mirror - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/no warranty booklet/no tools and jack/no spare tire/aircon fan issue/ taillight cover issue/cab headlining issue/cab seat partially missing/hard to lock cab door/hairline scratches on the body/rear room light issue/brake light issue/passenger side window riser issue/abnormal idling