

General Information

Date & Time: 19, Jun, 2026 15:56

Make	Mitsubishi	Model	Adventure
YOM	2017	Odo Meter Reading	106,332
Registration No.	NCA8446	Chassis No.	PAEVB5NHHHB019717
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	White		

Body / Panel Condition



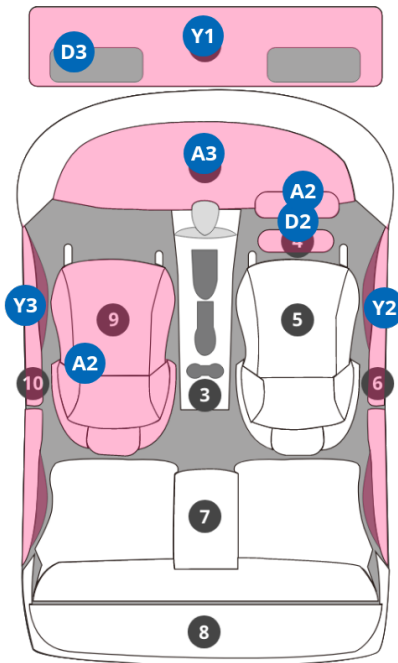
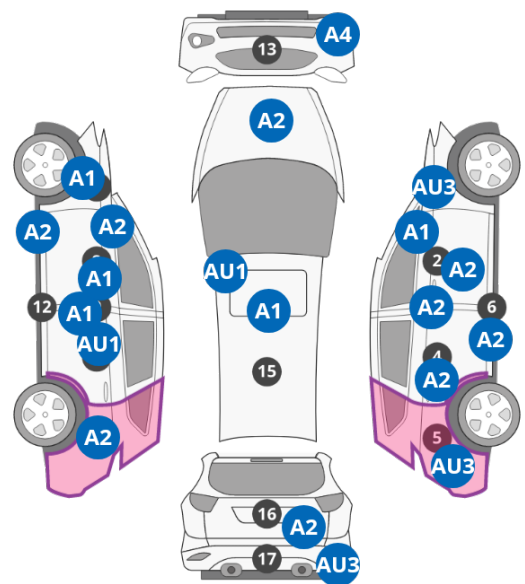
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	64.4	73	62	59
2	Boot Lid	300.7	761	59	83
3	Roof	62.0	65	58	65/61
4	Left Front Fender	83.5	109	71	71
5	Left Front Door	65.1	65	62	69
6	Center Panel Left				
7	Left Rear Door	65.4	66	66	64
8	Left Back Panel	135.3	94	137	175
9	Right Front Fender	77.7	75	72	85
10	Right Front Door	67.3	70	68	63
11	Center Panel Right				
12	Right Rear Door	74.3	73	66	84
13	Right Back Panel	166.3	261	116	122

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Small / Sunvisor, Sunglass Holder - Loose, Deformed - Medium / Steering Wheel - Worn, Peel, Crack - Medium / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Cut, Crack - Small / Ceiling - Grime - Minimal / Glove Box - Worn, Scratch, Cut, Crack - Small	Remarks (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Overall Exterior - Worn as per age - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Repair mark - Difference in Color / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Repair mark - Difference in Color / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (R) Center Panel - Scratch - Small / (L) Center Panel - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal / Roof Spoiler, Molding - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, faded headlights, scratches on taillights,