

General Information

Date & Time: 22, Feb, 2025 11:07

Make	Toyota	Model	Avanza
YOM	2021	Mileage	22,386
Registration No.	EAE3550	Chassis No.	MHKM5EF2FMK028286
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition



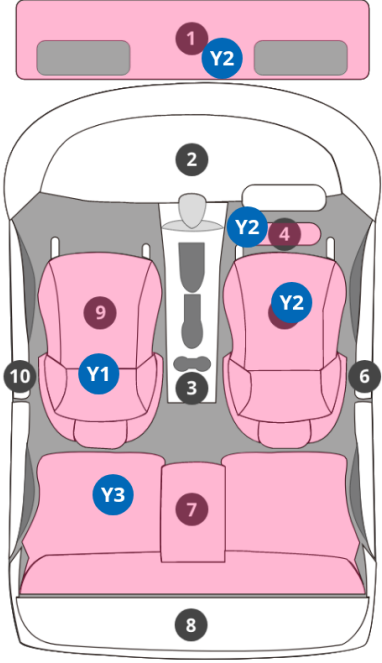
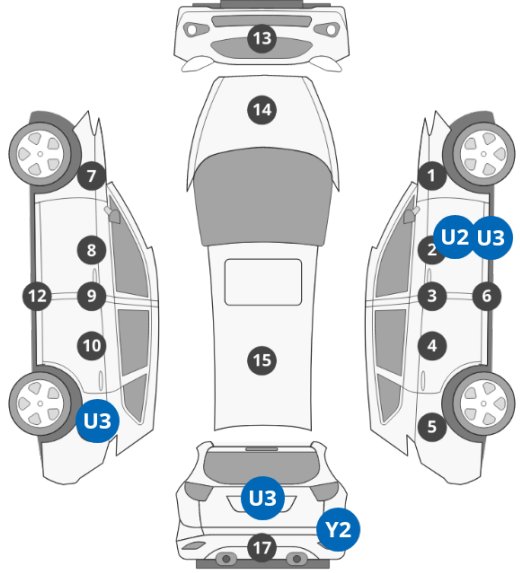
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	141.3	163	115	146
2	Boot Lid	86.8	85	90	86
3	Roof	91.4	83	80	103/99
4	Left Front Fender	72.5	74	71	73
5	Left Front Door	92.3	95	92	90
6	Center Panel Left				
7	Left Rear Door	96.5	93	97	99
8	Left Back Panel	81.8	74	77	95
9	Right Front Fender	86.3	82	83	94
10	Right Front Door	144.6	143	140	151
11	Center Panel Right				
12	Right Rear Door	186.6	181	163	216
13	Right Back Panel	165.6	182	154	161

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / Ceiling - Grime - Small / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (L) Rear Fender, Molding - Dent - Medium / Trunk Hood, Rear Gate - Dent - Medium / (R) Step, In-panel, Side Spoiler - Dent - Medium / (R) Front Door, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with spare tire. without warranty booklet, tools and jack. with LTO plate. crack right tail light.