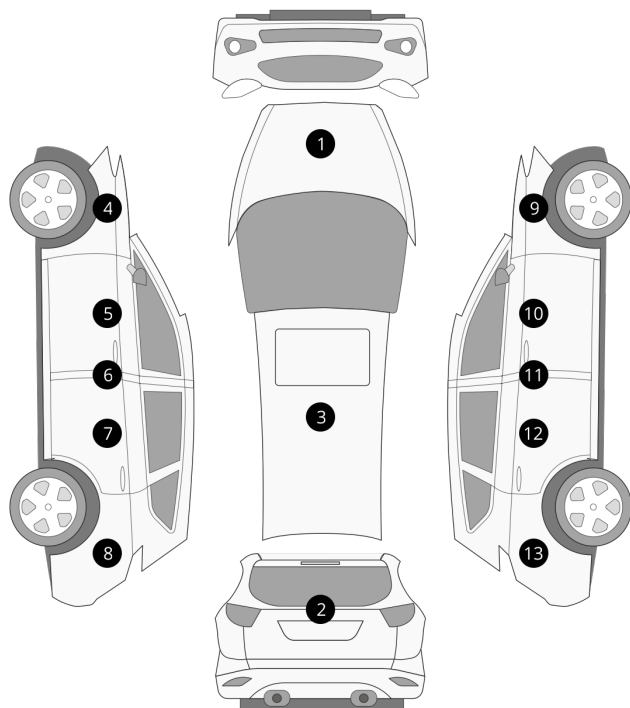


## General Information

Date & Time: 15, Jun, 2026 11:17

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Hyundai | Model             | Stargazer         |
| YOM              | 2023    | Odo Meter Reading | 10,566            |
| Registration No. | GBA6045 | Chassis No.       | MF3NC81DEPJ028142 |
| CC               | 1.5     | Transmission      | CVT               |
| Fuel Type        | Gas     | Type of Body      | MPV               |
| Colour           | White   |                   |                   |

## Body / Panel Condition



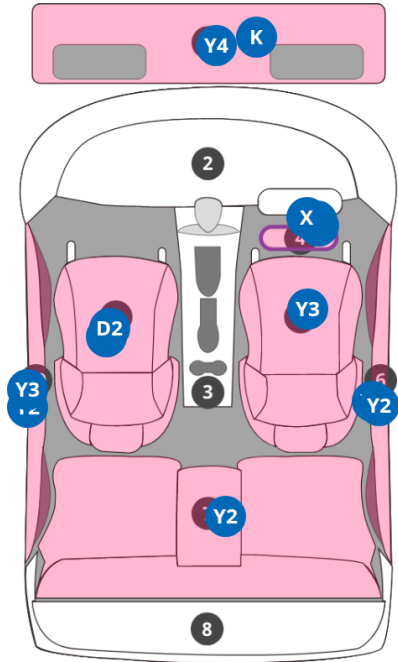
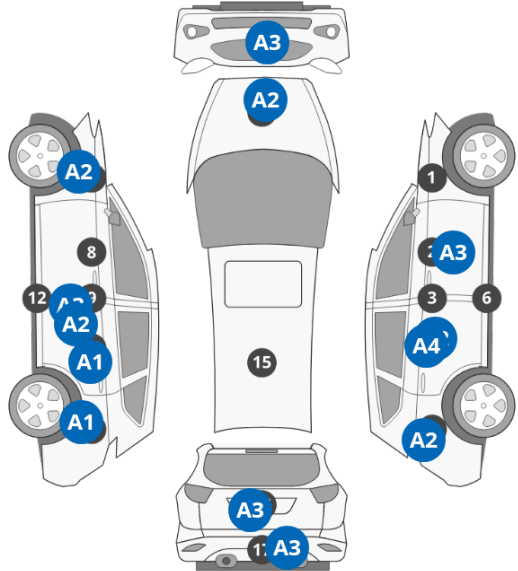
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 143.6         | 143    | 138    | 150      |
| 2  | Boot Lid           | 117.3         | 119    | 119    | 114      |
| 3  | Roof               | 136.2         | 132    | 139    | 135/139  |
| 4  | Left Front Fender  | 130.3         | 114    | 142    | 135      |
| 5  | Left Front Door    | 117.3         | 119    | 115    | 118      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 116.3         | 113    | 118    | 118      |
| 8  | Left Back Panel    | 130.3         | 126    | 130    | 135      |
| 9  | Right Front Fender | 121.0         | 132    | 123    | 108      |
| 10 | Right Front Door   | 123.3         | 116    | 114    | 140      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 122.6         | 126    | 120    | 122      |
| 13 | Right Back Panel   | 143.0         | 146    | 139    | 144      |

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <span style="color: red;">C</span>                                                                                                                                                                                                                                                                                                                                                                                                                    | Exterior Evaluation : <span style="color: red;">E</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                                                                                                                                                                                                                          |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                 |
| <b>Remarks</b><br>(R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Overall Interior - Animal Hair - Yes / Ceiling - Grime - Large / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Small / Rear Seat - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Seat belt - Loose, Deformed - Small | <b>Remarks</b><br>(L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small |
| Frame Evaluation : <span style="color: red;">A</span>                                                                                                                                                                                                                                                                                                                                                                                                                       | Functional Evaluation : <span style="color: red;">C</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                                                                                                                                                                                                                                         | <b>Remarks</b><br>Warning Lamps - Issue - Yes / Battery - Weak - Yes                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |

| Inspector Notes                                                                                                       |
|-----------------------------------------------------------------------------------------------------------------------|
| Left rear molding glass crack. Without Seatcover, LTO plate. With warranty booklet, sparetire, jack, tools and 2keys. |