

General Information

Date & Time: 18, Jun, 2026 19:17

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	31,690
Registration No.	NLA6894	Chassis No.	PAHACACA9S6428063
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



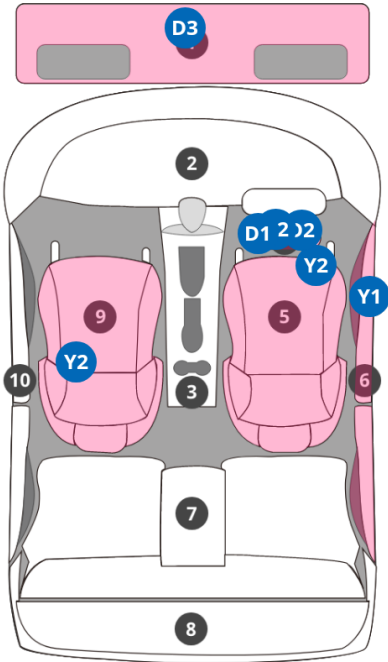
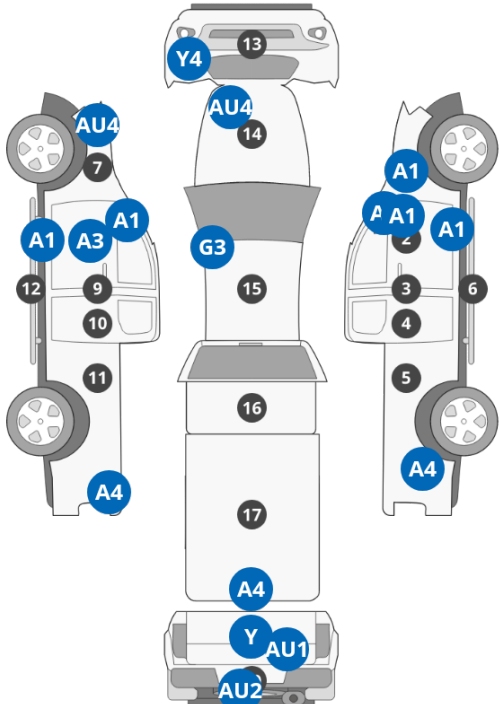
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.5	105	98	108
2	Boot Lid	53.6	53	47	61
3	Roof	120.0	121	135	114/110
4	Left Front Fender	105.8	99	108	110
5	Left Front Door	103.4	96	108	106
6	Center Panel Left	91.3	105	87	82
7	Left Rear Door				
8	Left Back Panel	66.3	61	74	64
9	Right Front Fender	108.8	116	114	97
10	Right Front Door	106.6	105	106	109
11	Center Panel Right	100.6	116	99	87
12	Right Rear Door				
13	Right Back Panel	73.7	67	87	67

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Loose, Deformed - Medium / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Worked - Small / Carpet - Worked - Minimal / (L) Front Seat - Grime - Small	Remarks Antennae - Damaged - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Side Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Cargo Bed Floor - Scratch - Large / Rear Gate - Scratch & Dent - Minimal / (L) Side Gate - Scratch - Large / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / Front Windshield - Scratch, Stone chip - Medium
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate.,with spare tire and warranty booklet, 1key, no jack and tools, cracked headlight and taillight,hood issue