

General Information

Date & Time: 18, Jun, 2026 15:08

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	21,595
Registration No.	CDA8082	Chassis No.	PAHACACA0S6429232
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



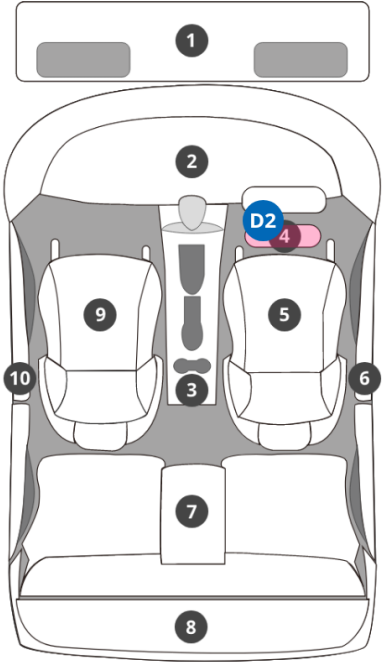
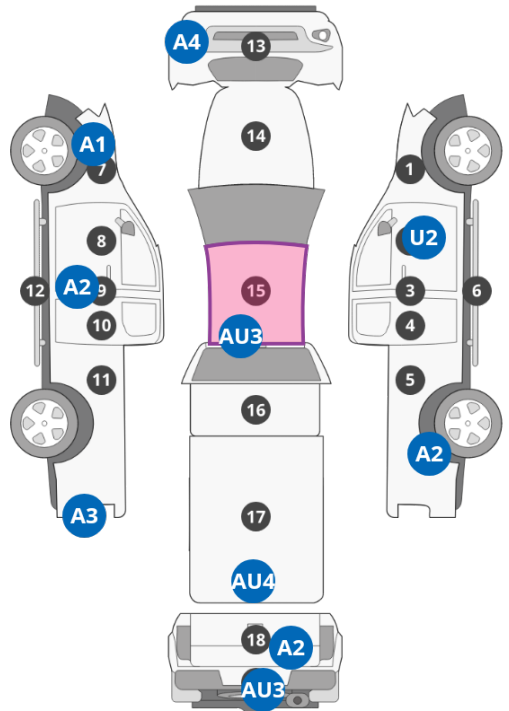
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.3	102	111	103
2	Boot Lid	67.7	64	67	72
3	Roof	100.5	106	105	67/124
4	Left Front Fender	111.3	105	100	129
5	Left Front Door	117.6	105	105	143
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	69.6	63	78	67
9	Right Front Fender	103.0	104	101	104
10	Right Front Door	109.0	105	108	114
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	56.2	57	57	55

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small	Remarks Front Bumper, Grille, Lamps - Scratch - Large / (L) Guard Frame - Scratch - Medium / Cargo Bed Floor - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Front Door, Molding - Dent - Small / Roof - Repair mark - Yes / Roof - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (R) Side Gate - Scratch - Small / Rear Gate - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
light scratches around the exterior/ no spare tire/ with jack and tools/ with LTO Plate and warranty booklet/