

General Information

Date & Time: 24, Feb, 2025 10:52

Make	Toyota	Model	Vios
YOM	2017	Mileage	75,187
Registration No.	NBZ5175	Chassis No.	PA1B29F36H8002339
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



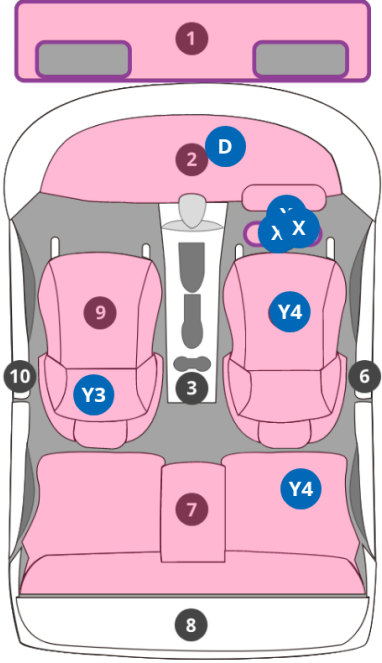
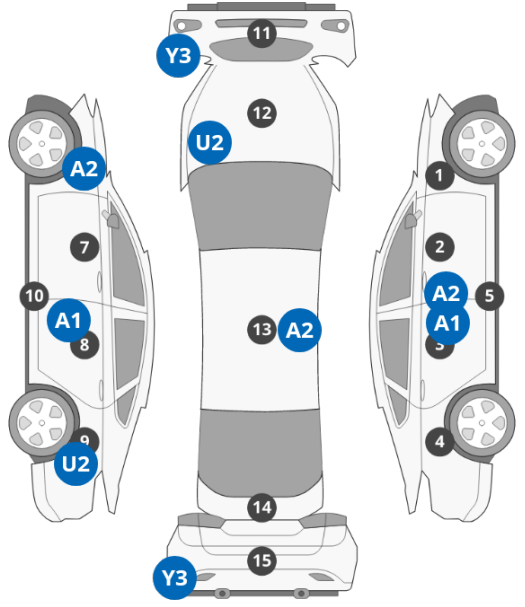
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	167.3	179	155	168
2	Boot Lid	153.6	162	147	152
3	Roof	188.0	121	357	134/140
4	Left Front Fender	184.0	168	205	179
5	Left Front Door	158.6	158	157	161
6	Center Panel Left				
7	Left Rear Door	141.3	151	133	140
8	Left Back Panel	206.0	177	219	222
9	Right Front Fender	163.6	165	162	164
10	Right Front Door	154.6	154	145	165
11	Center Panel Right				
12	Right Rear Door	154.0	141	149	172
13	Right Back Panel	312.6	542	180	216

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Room Lamp - Missing - Yes	Remarks (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Dent - Small / Roof - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium
Frame Evaluation : B	Functional Evaluation : B
Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
no warranty booklet, no jack, no tools, with spare tire, with LTO plate, shift knob missing, room lamp missing, weak battery, loose spoiler, possible flooding, no reverse camera