

General Information

Date & Time: 18, Jun, 2026 20:39

Make	Mitsubishi	Model	Mirage
YOM	2022	Odo Meter Reading	63,036
Registration No.	GAR8412	Chassis No.	PAEA13RXNMA013961
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



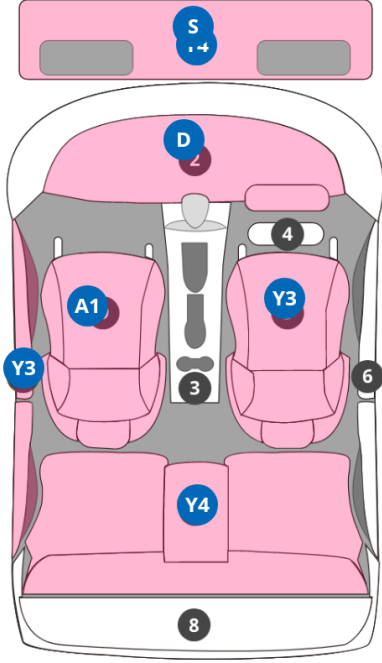
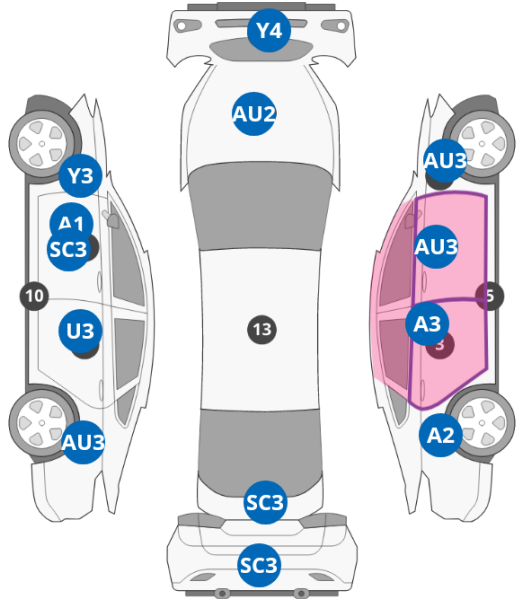
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.3	131	119	120
2	Boot Lid	161.3	164	156	164
3	Roof	105.7	108	109	104/102
4	Left Front Fender	110.0	117	105	108
5	Left Front Door	105.6	109	105	103
6	Center Panel Left				
7	Left Rear Door	100.8	107	101	94
8	Left Back Panel	130.6	131	131	130
9	Right Front Fender	206.6	225	204	191
10	Right Front Door	179.3	175	178	185
11	Center Panel Right				
12	Right Rear Door	374.0	541	306	275
13	Right Back Panel	386.3	186	234	739

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / Ceiling - Grime - Large / Rear Seat - Grime - Large / (L) Front Seat - Cut, Crack - Minimal / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Smell - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Repair mark - Difference in Color / (R) Rear Door, Molding - Repair mark - Difference in Color / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Crack, Gap - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Rust, Corrosion - Medium / (L) Rear Door, Molding - Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch & Dent - Small / Trunk Hood, Rear Gate - Rust, Corrosion - Medium / Rear Bumper, Lamps, Panels - Rust, Corrosion - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

With LTO plate, no warranty booklet, no spare key, with spare tire, no seat cover, with tools, with jack, with hairline scratches, with warning device, with slight bad smell.