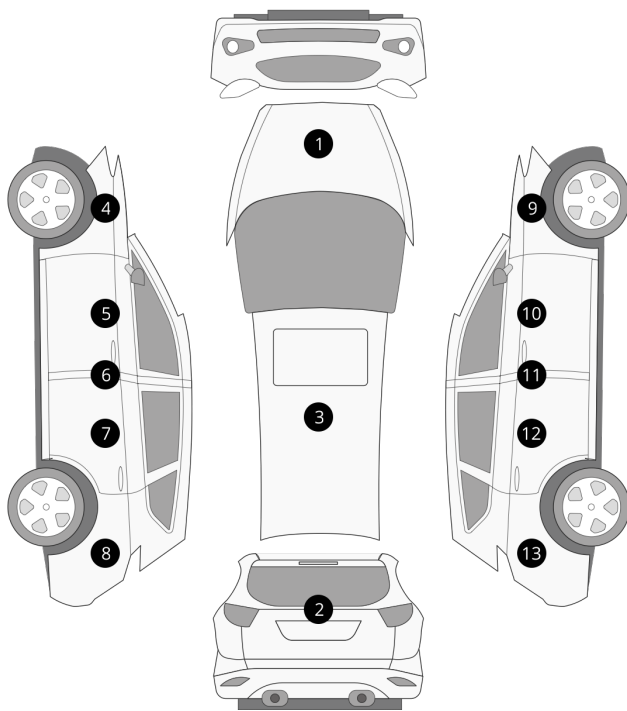


General Information

Date & Time: 26, Feb, 2025 13:43

Make	Suzuki	Model	Carry
YOM	2022	Mileage	48,407
Registration No.	NHD2777	Chassis No.	MHYDC61T4PJ211318
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



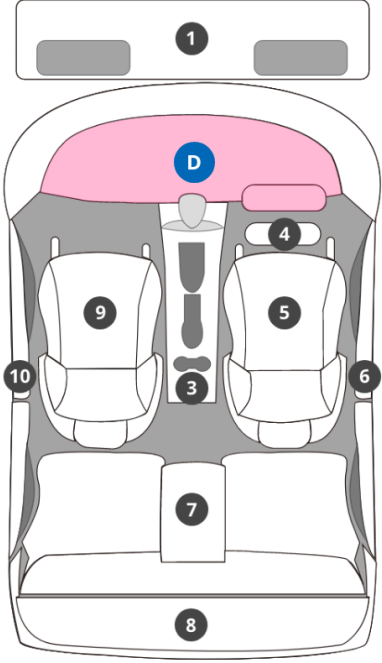
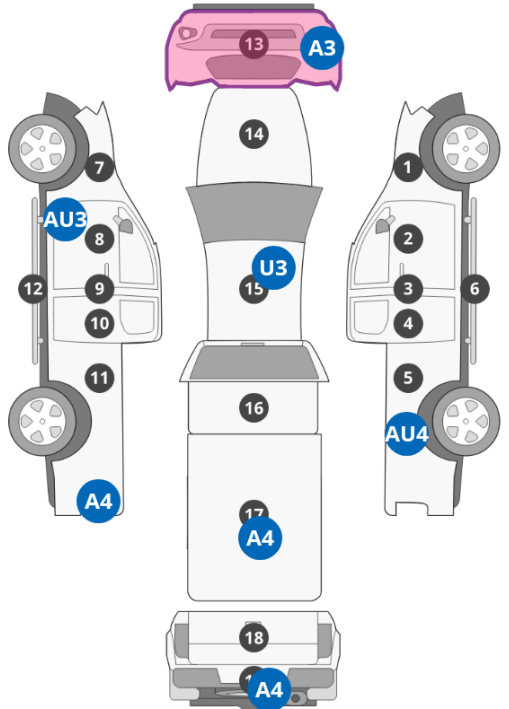
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	115	98	115
2	Boot Lid	131.0	151	115	127
3	Roof	97.6	102	105	85/98
4	Left Front Fender	119.6	106	127	126
5	Left Front Door	106.7	112	110	98
6	Center Panel Left	99.1	100	101	96
7	Left Rear Door				
8	Left Back Panel	152.6	192	133	133
9	Right Front Fender	119.3	119	119	120
10	Right Front Door	102.9	98	111	100
11	Center Panel Right	101.5	96	110	99
12	Right Rear Door				
13	Right Back Panel	214.6	158	298	188

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes	Remarks (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Corner Panel - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Side Gate - Scratch - Large / (R) Side Gate - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / Roof - Dent - Medium / Cargo Bed Floor - Scratch - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes

with warranty booklet and spare tire/ no tools and jack/ with LTO plate/?