

General Information

Date & Time: 27, Jul, 2026 15:32

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	14,771
Registration No.	NJK3040	Chassis No.	PAHACACA1S6428266
CC	2.4	Transmission	M/T
Fuel Type	Gas	Type of Body	Utility Vehicle
Colour	White		

Body / Panel Condition



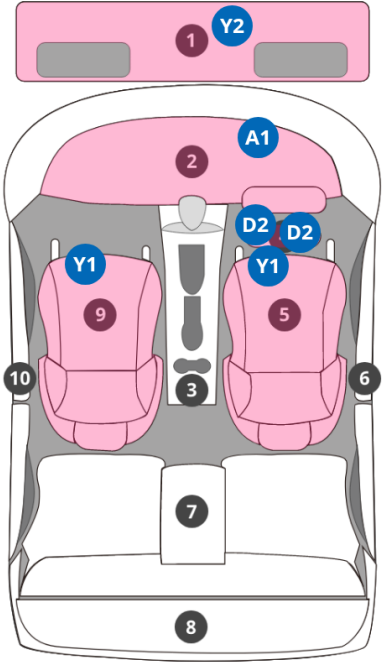
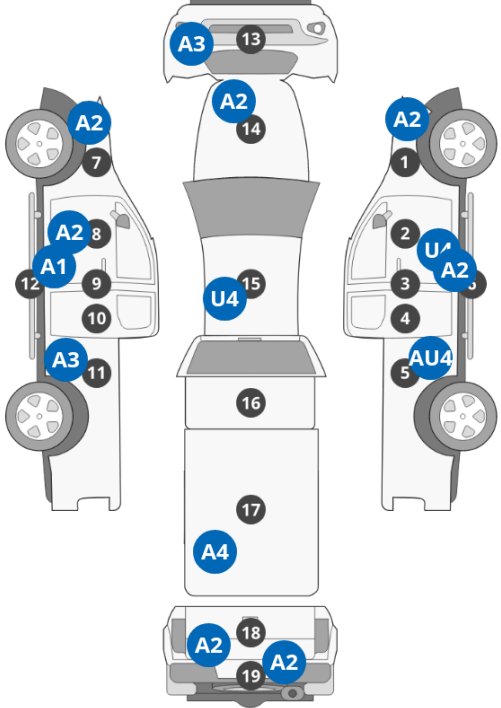
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	177.0	179	189	163
2	Boot Lid	110.3	100	112	119
3	Roof	176.2	200	192	135/178
4	Left Front Fender	187.3	182	181	199
5	Left Front Door	176.6	180	170	180
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	118.6	132	107	117
9	Right Front Fender	188.6	196	186	184
10	Right Front Door	182.3	176	188	183
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	112.3	107	116	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Worn, Scratch, Cut, Crack - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Ceiling - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Dent - Large / (R) Side Gate - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Scratch - Small / Cargo Bed Floor - Scratch - Large / (L) Side Gate - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Dent - Large
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes

Inspector Notes
with Ito plate/with spare tire/with warranty booklet/with spare key/with dent and scratches on the body/unable to identify functional due to non moving unit no key/non moving unit no key/taillight damage