

General Information

Date & Time: 24, Jun, 2026 07:36

Make	Toyota	Model	Fortuner
YOM	2023	Odo Meter Reading	48,299
Registration No.	DBI218	Chassis No.	MHFCB8GS5P3527235
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	White		

Body / Panel Condition



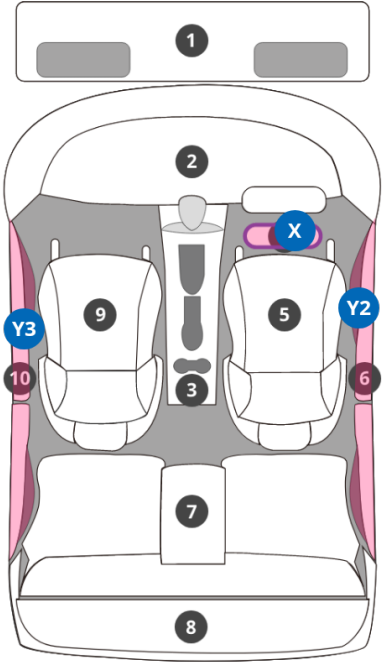
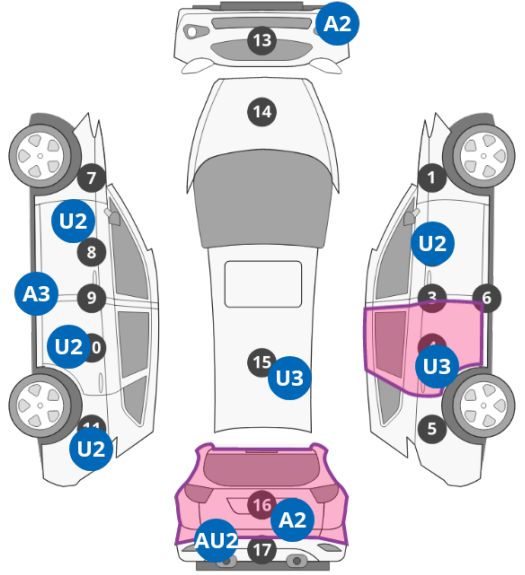
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	110	113	112
2	Boot Lid	200.0	163	210	227
3	Roof	158.2	113	113	91/316
4	Left Front Fender	140.0	141	141	138
5	Left Front Door	150.3	166	130	155
6	Center Panel Left				
7	Left Rear Door	121.3	122	122	120
8	Left Back Panel	198.6	215	184	197
9	Right Front Fender	136.6	146	128	136
10	Right Front Door	162.6	178	168	142
11	Center Panel Right				
12	Right Rear Door	170.0	204	161	145
13	Right Back Panel	159.0	143	137	197

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Medium / Mat Other - Missing - Yes / (R) Front Trim - Grime - Small	Remarks (R) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Rear Door, Molding - Dent - Medium / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Door, Molding - Dent - Small / (L) Front Door, Molding - Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Front Door, Molding - Dent - Small / Roof - Dent - Medium / (L) Rear Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Trunk Hood, Rear Gate - Partially Missing - Yes / (R) Rear Door, Molding - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ no jack and tools/ light scratches around the exterior/ with LTO Plate and Sparetire/