

General Information

Date & Time: 24, Jun, 2026 16:31

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	124,578
Registration No.	NIS4517	Chassis No.	PA1B18F38P4220788
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



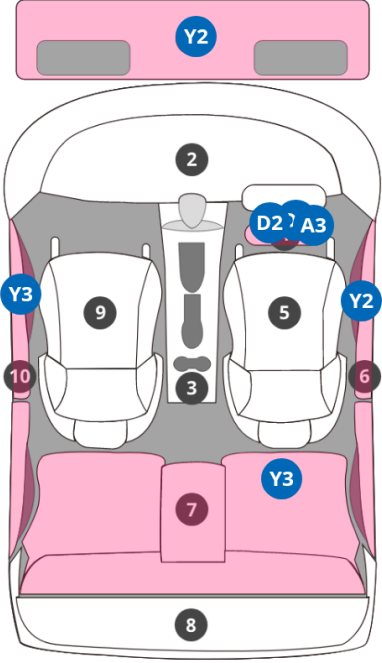
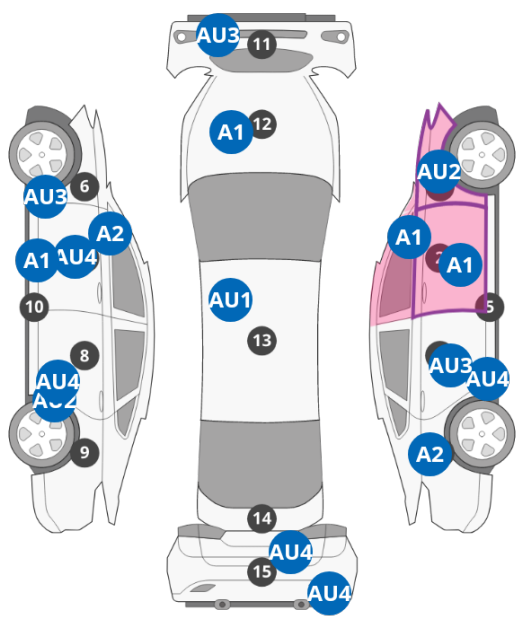
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	201.3	196	205	203
2	Boot Lid	118.6	112	115	129
3	Roof	100.9	100	102	98/104
4	Left Front Fender	103.3	100	101	109
5	Left Front Door	105.0	105	109	101
6	Center Panel Left				
7	Left Rear Door	99.1	99	97	101
8	Left Back Panel	114.3	112	122	109
9	Right Front Fender	146.0	133	145	160
10	Right Front Door	173.6	210	152	159
11	Center Panel Right				
12	Right Rear Door	108.0	100	101	123
13	Right Back Panel	102.6	100	100	108

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Rear Seat - Grime - Medium / Carpet - Worked - Large / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with warranty booklet and jack, 1key, no spare tire and tools, scratches on headlights, Crack taillight, plate light issue, Worn tires