

General Information

Date & Time: 24, Jun, 2026 16:32

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	41,671
Registration No.	NHT2034	Chassis No.	MHFAA1BY2S0038847
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



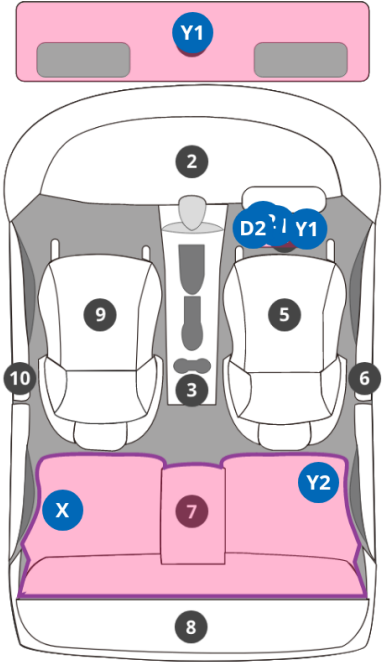
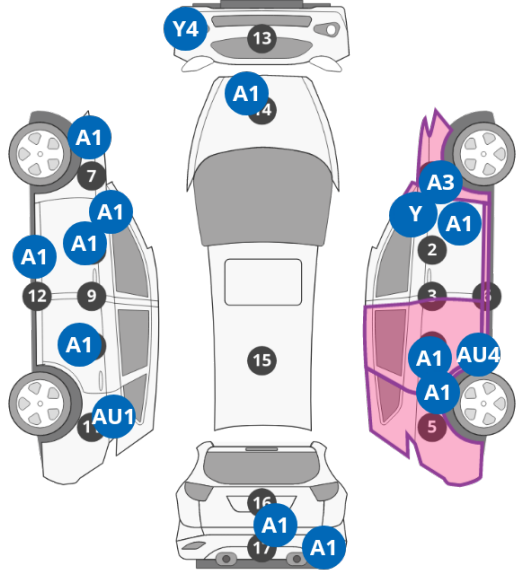
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	163.0	159	173	157
2	Boot Lid	116.6	121	111	118
3	Roof	114.0	121	124	110/101
4	Left Front Fender	127.3	135	121	126
5	Left Front Door	118.3	111	112	132
6	Center Panel Left				
7	Left Rear Door	119.0	120	112	125
8	Left Back Panel	131.6	140	111	144
9	Right Front Fender	314.6	147	644	153
10	Right Front Door	113.3	117	114	109
11	Center Panel Right				
12	Right Rear Door	262.0	466	166	154
13	Right Back Panel	673.3	221	1,025	774

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Floor Mat - Grime - Minimal / Ceiling - Grime - Minimal / Carpet - Worked - Minimal / (L) Front Floor Mat - Worked - Small / Mat Other - Worked - Small / Rear Seat - Partially Missing - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Minimal / (R) Mirror - Crack - Damaged / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : C	Functional Evaluation : D
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Power Steering - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, with warranty booklet, 1key, no tools, scratches on headlights, airbag warning lamp on, steering wheel warning lamp on, maintenance warning lamp on, right headlight issue