

General Information

Date & Time: 24, Jun, 2026 16:38

Make	Toyota	Model	Innova
YOM	2023	Odo Meter Reading	28,736
Registration No.	NIL3948	Chassis No.	PA2JA8EM9P0121518
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



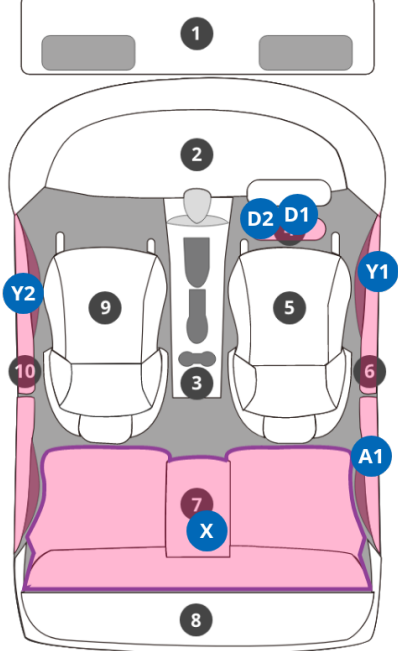
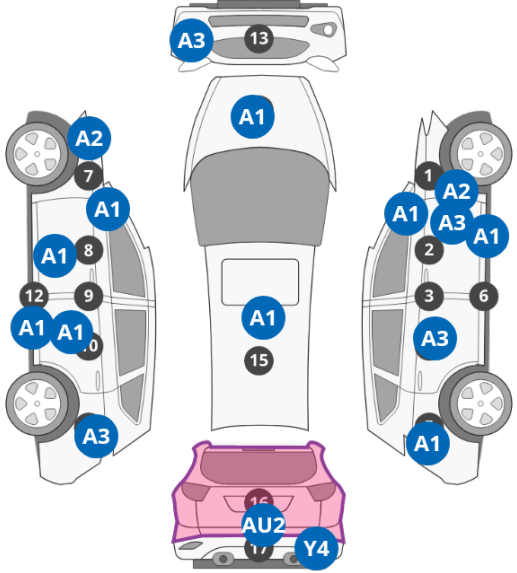
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	113	114	108
2	Boot Lid	466.0	98	100	1,200
3	Roof	92.8	92	98	90/92
4	Left Front Fender	110.3	122	107	102
5	Left Front Door	99.7	95	102	102
6	Center Panel Left				
7	Left Rear Door	105.4	119	100	97
8	Left Back Panel	105.2	97	106	113
9	Right Front Fender	101.0	104	98	101
10	Right Front Door	102.0	99	103	104
11	Center Panel Right				
12	Right Rear Door	104.9	100	109	106
13	Right Back Panel	108.3	110	105	110

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat Head Rest - Partially Missing - Yes / (R) Front Trim - Grime - Minimal / Trim Other - Cut, Crack - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Carpet - Worked - Minimal	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
With Lto plate, with spare tire and jack, with warranty, 2keys, no tools, scratches on headlights, Crack taillight