

General Information

Date & Time: 25, Jun, 2026 17:23

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	18,456
Registration No.	FBA1055	Chassis No.	PAHACACA5S6430831
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Vehicle
Colour	White		

Body / Panel Condition



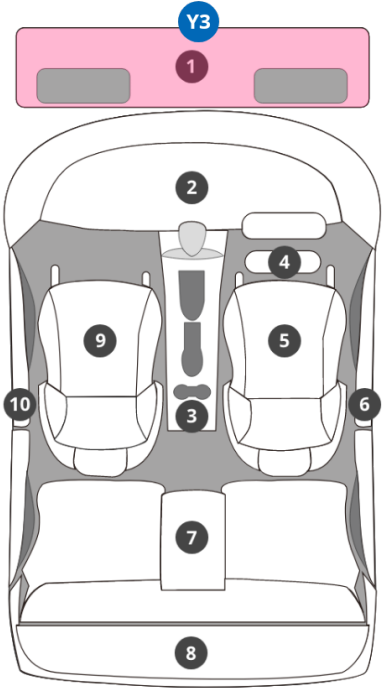
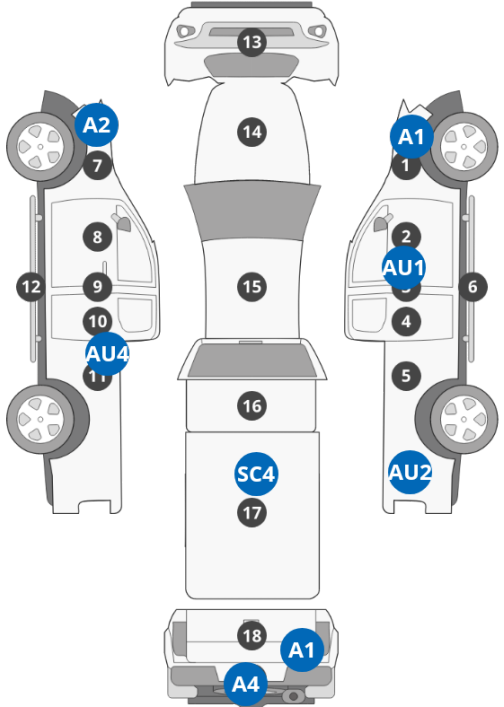
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	90.7	90	92	91
2	Boot Lid	47.0	52	43	47
3	Roof	92.5	93	95	87/96
4	Left Front Fender	97.1	95	97	99
5	Left Front Door	99.7	100	99	100
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	65.2	59	79	58
9	Right Front Fender	91.1	93	89	91
10	Right Front Door	93.3	93	92	96
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	66.7	72	65	63

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Side Gate - Scratch & Dent - Small / Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / Cargo Bed Floor - Rust, Corrosion - Large / (L) Side Gate - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

with Ito plate, with spare key, with warranty booklet, with spare tire, no jack, with tools, left front seat frame with rust, hairline scratches in the body