

General Information

Date & Time: 27, Jun, 2026 13:10

Make	Hyundai	Model	Accent
YOM	2016	Odo Meter Reading	81,337
Registration No.	NDX8185	Chassis No.	KMHCT41UGGU060623
CC	1.6	Transmission	A/T
Fuel Type	Diesel	Type of Body	Sedan
Colour	Beige		

Body / Panel Condition



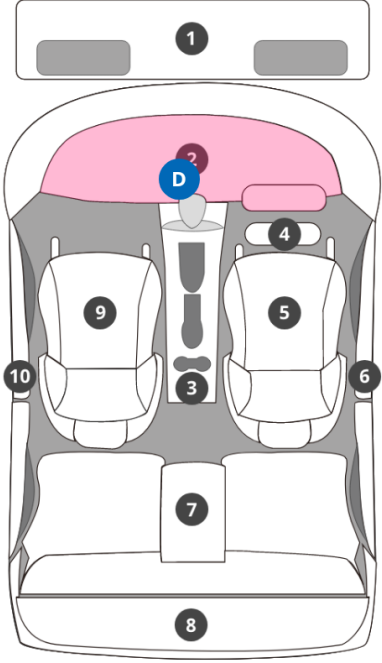
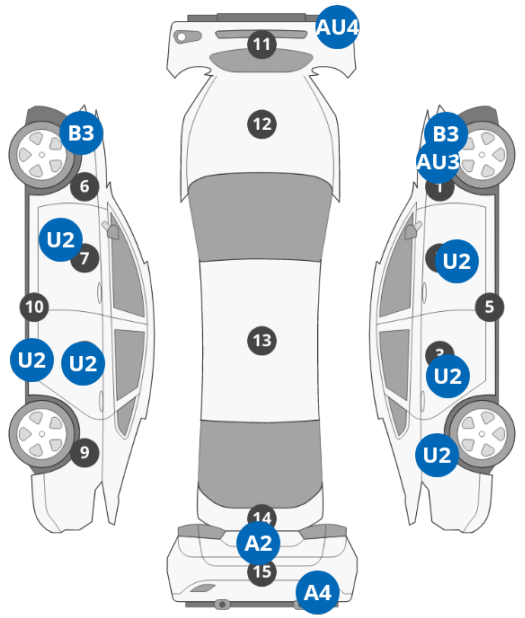
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	169.0	167	164	176
2	Boot Lid	173.6	197	157	167
3	Roof	102.7	124	110	91/86
4	Left Front Fender	365.0	603	324	168
5	Left Front Door	159.0	148	148	181
6	Center Panel Left				
7	Left Rear Door	156.6	161	156	153
8	Left Back Panel	540.6	557	433	632
9	Right Front Fender	176.0	152	181	195
10	Right Front Door	134.0	147	137	118
11	Center Panel Right				
12	Right Rear Door	141.3	143	133	148
13	Right Back Panel	447.6	746	395	202

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Repair Mark - Yes / Overall Interior - Worn as per age - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Front Door, Molding - Dent - Small / (L) Step, In-panel, Side Spoiler - Dent - Small / (L) Front Door, Molding - Dent - Small / (L) Front Fender, Molding - Modified - Medium / (R) Front Fender, Molding - Modified - Medium / Trunk Hood, Rear Gate - Scratch - Small / (R) Front Door, Molding - Dent - Small / (R) Rear Door, Molding - Dent - Small
Frame Evaluation : D	Functional Evaluation : C
Remarks Left Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
light scratches around the exterior/ no tools/ no warranty booklet/ possible flooding/ abnormal engine noise and vibration/ with check engine light on/ with jack and spare tire/ with LTO plate/