

General Information

Date & Time: 27, Jun, 2026 13:08

Make	Toyota	Model	Hiace
YOM	2024	Odo Meter Reading	253,533
Registration No.	EAJ1404	Chassis No.	JTFJT02P1P5035267
CC	3.0	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	Silver		

Body / Panel Condition



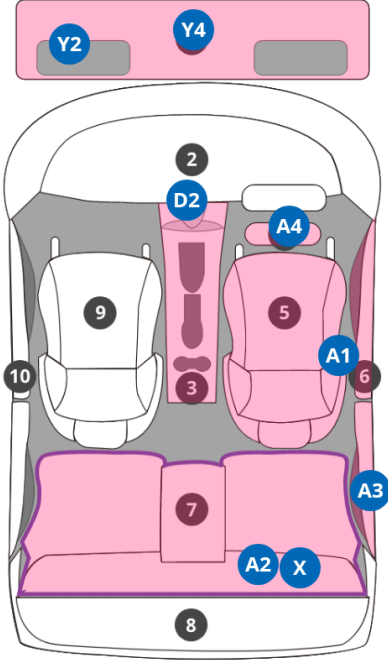
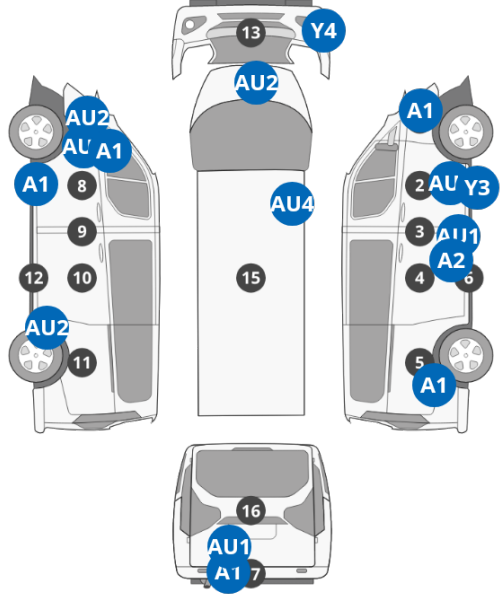
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	99	125	100
2	Boot Lid	105.3	109	107	100
3	Roof	114.0	121	104	119/112
4	Left Front Fender	106.0	113	101	104
5	Left Front Door	96.6	89	98	103
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	102.8	100	92	117
9	Right Front Fender	111.0	108	115	110
10	Right Front Door	106.7	108	113	99
11	Center Panel Right	107.6	117	106	100
12	Right Rear Door	173.0	171	158	190
13	Right Back Panel	127.3	138	113	131

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / Rear Seat - Partially Missing - Yes / Carpet - Worn, Scratch, Cut, Crack - Large / Trim Other - Cut, Crack - Medium / Rear Seat - Cut, Crack - Small / (R) Front Seat belt - Cut, Crack - Minimal / Sunvisor, Sunglass Holder - Grime - Small / Console, Switchs, Vents - Loose, Deformed - Small	Remarks (L) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Crack, Gap - Medium / (R) Center Panel - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
No Lto plate, no tools, 1key, with spare tire and jack and warranty booklet, scratches on headlights and taillights, right side mirror issue, rear seat handle missing,