

General Information

Date & Time: 27, Jun, 2026 13:07

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	105,580
Registration No.	NFC8362	Chassis No.	PA1B18F37P4220989
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



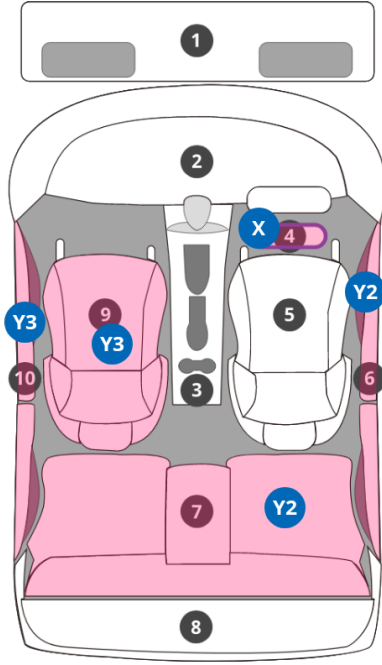
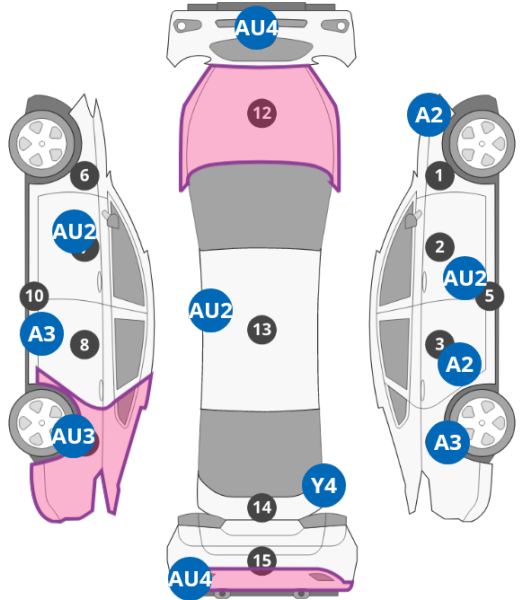
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	136.3	136	134	139
2	Boot Lid	110.6	106	114	112
3	Roof	112.2	106	103	121/119
4	Left Front Fender	225.6	133	150	394
5	Left Front Door	161.0	181	150	152
6	Center Panel Left				
7	Left Rear Door	110.3	120	111	100
8	Left Back Panel	123.0	146	109	114
9	Right Front Fender	135.6	101	199	107
10	Right Front Door	101.5	101	99	105
11	Center Panel Right				
12	Right Rear Door	106.3	103	102	114
13	Right Back Panel	125.6	100	112	165

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Floor Mat - Missing - Yes / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Crack, Gap - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
incomplete tools/ possible flooding/ light scratches around the exterior/ with jack and spare tire/ with LTO plate and warranty booklet/