

General Information

Date & Time: 27, Jun, 2026 13:09

Make	Toyota	Model	Wigo
YOM	2018	Odo Meter Reading	117,922
Registration No.	CAM5315	Chassis No.	MHKA4DF5FJJ018239
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	White		

Body / Panel Condition



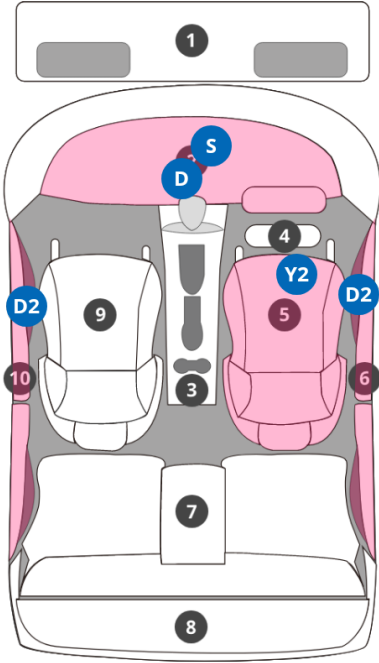
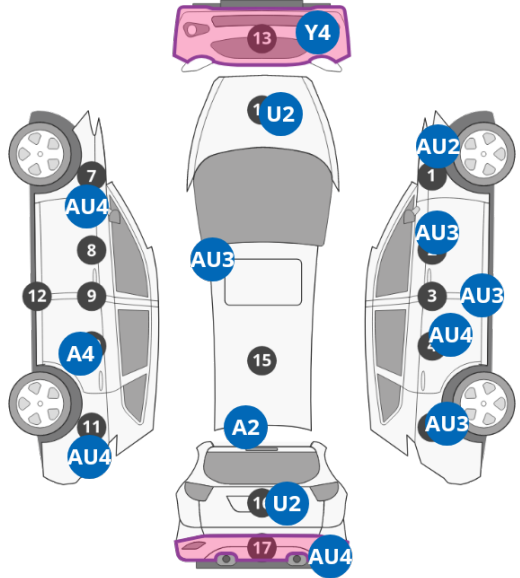
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	186.6	173	235	152
2	Boot Lid	307.0	633	143	145
3	Roof	70.1	60	80	69/71
4	Left Front Fender	455.0	461	725	179
5	Left Front Door	182.6	186	171	191
6	Center Panel Left				
7	Left Rear Door	108.4	112	98	115
8	Left Back Panel	212.9	93	118	428
9	Right Front Fender	260.6	280	262	240
10	Right Front Door	228.3	246	226	213
11	Center Panel Right				
12	Right Rear Door	211.3	219	179	236
13	Right Back Panel	213.0	298	162	179

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Overall Interior - Smell - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Large / Roof - Scratch & Dent - Medium / Roof Spoiler, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Window (each) - Stuck, Gap - Yes / Spare Key - Issue - Unexist

Inspector Notes

light scratches around the exterior/ power window issue/possible flooding/light scratches around the exterior/with jack and spare tire/ with LTO plate and warranty booklet/ with tools