

General Information

Date & Time: 27, Jun, 2026 18:00

Make	Hyundai	Model	Accent
YOM	2019	Odo Meter Reading	1
Registration No.	FAE3029	Chassis No.	KMHCT41BEJU431859
CC	1.4	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



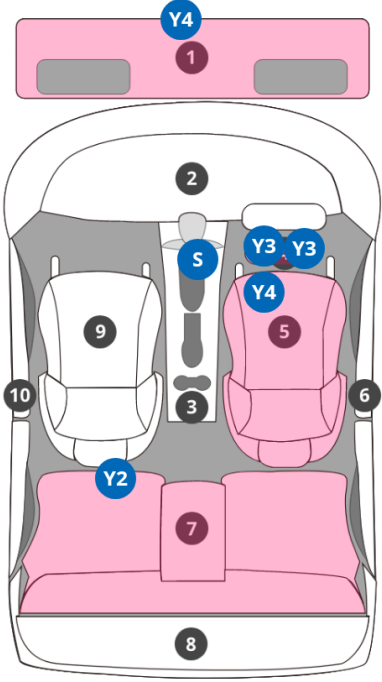
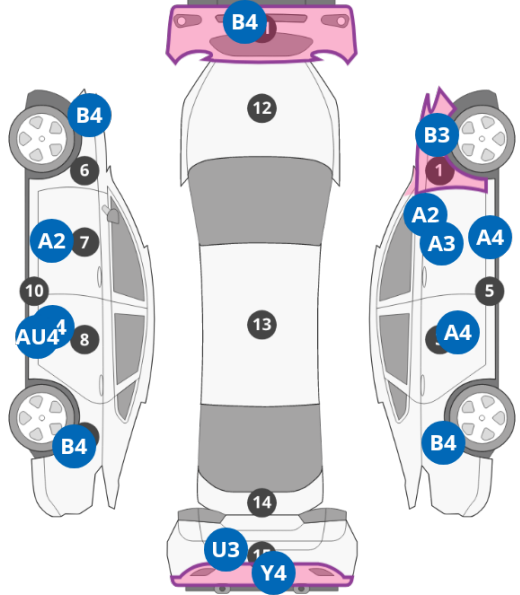
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.3	96	99	97
2	Boot Lid	107.6	112	110	101
3	Roof	88.3	101	100	76/77
4	Left Front Fender	115.7	87	164	97
5	Left Front Door	95.2	90	96	100
6	Center Panel Left				
7	Left Rear Door	89.6	99	90	80
8	Left Back Panel	92.7	91	95	93
9	Right Front Fender	94.0	92	103	87
10	Right Front Door	90.4	94	95	82
11	Center Panel Right				
12	Right Rear Door	93.2	81	93	106
13	Right Back Panel	89.6	86	88	95

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Small / Ceiling - Grime - Large / Overall Interior - Smell - Yes	Remarks (R) Step - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Modified - Medium / (R) Front Fender, Molding - Repair mark - Yes / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Modified - Large / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Dent - Medium / (L) Rear Fender, Molding - Modified - Large / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Modified - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Modified - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with lto plate, no warranty booklet, no spare tire, no jack, no tools, no spare key, functionality can not be checked due to missing battery, missing battery, hairline scratches in the body