

General Information

Date & Time: 02, Jul, 2026 05:08

Make	Mitsubishi	Model	Mirage
YOM	2020	Odo Meter Reading	58,857
Registration No.	CBK1189	Chassis No.	PAEA13RJLLA016824
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



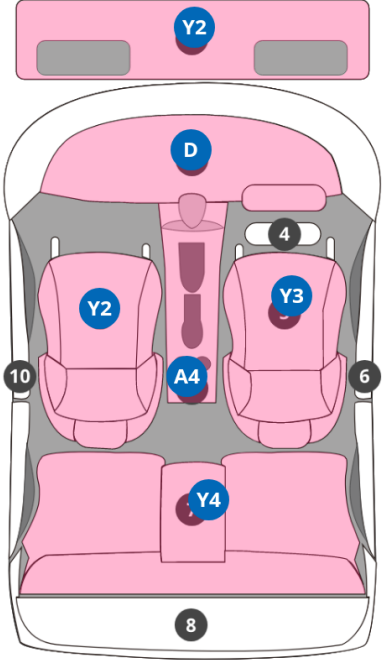
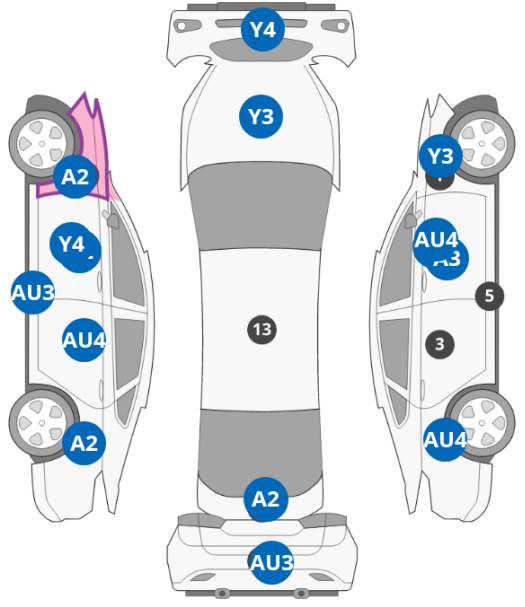
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	195.0	174	186	225
2	Boot Lid	116.6	116	120	114
3	Roof	110.2	114	111	107/109
4	Left Front Fender	603.6	515	1,125	171
5	Left Front Door	107.3	107	106	109
6	Center Panel Left				
7	Left Rear Door	111.6	115	111	109
8	Left Back Panel	123.6	125	121	125
9	Right Front Fender	108.6	103	110	113
10	Right Front Door	109.6	112	109	108
11	Center Panel Right				
12	Right Rear Door	112.6	108	106	124
13	Right Back Panel	131.0	125	130	138

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Seat - Grime - Small / Rear Seat - Grime - Large / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Large	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Crack, Gap - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Repair mark - Difference in Color / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Crack, Gap - Medium / Antennae - Damaged - Yes / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Front Door, Molding - Crack, Gap - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate, no warranty booklet, with tools, with jack, no spare key, with spare tire, no seat cover, with hairline scratches, no reverse camera, cut/modified radio rack.