

General Information

Date & Time: 02, Jul, 2026 15:59

Make	Nissan	Model	NV350
YOM	2020	Odo Meter Reading	109,200
Registration No.	NAN3097	Chassis No.	JN1TC2E26Z0061630
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



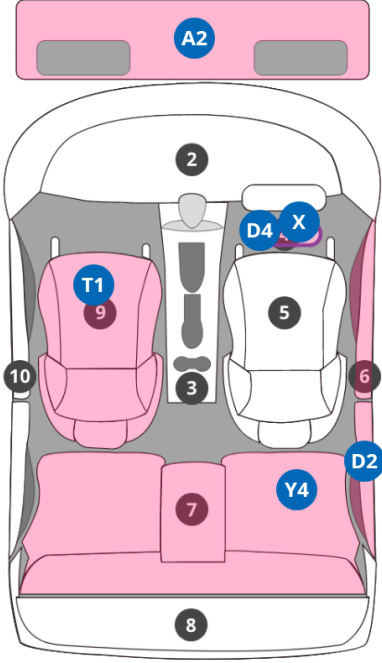
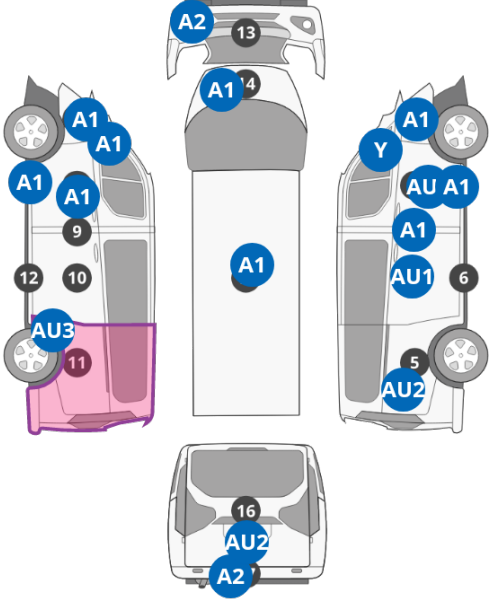
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	204.6	131	249	234
2	Boot Lid	195.0	157	226	202
3	Roof	106.4	91	88	102/145
4	Left Front Fender	178.0	145	202	187
5	Left Front Door	150.6	112	174	166
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	185.3	213	213	130
9	Right Front Fender	98.0	93	100	101
10	Right Front Door	94.3	90	91	102
11	Center Panel Right	95.6	97	103	87
12	Right Rear Door	94.5	79	111	94
13	Right Back Panel	101.3	104	99	101

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / Carpet - Worked - Large / Rear Seat - Grime - Large / Ceiling - Cut, Crack - Small / Trim Other - Worked - Small / (L) Front Seat - Cigarette Burns - Burnt Minimal	Remarks Front Panel - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Crack - Cracks / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Center Panel - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Repair mark - Difference in Color / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Panel - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with jack, 1key, no spare tire and warranty booklet and tools, scratches on headlights, Crack taillight