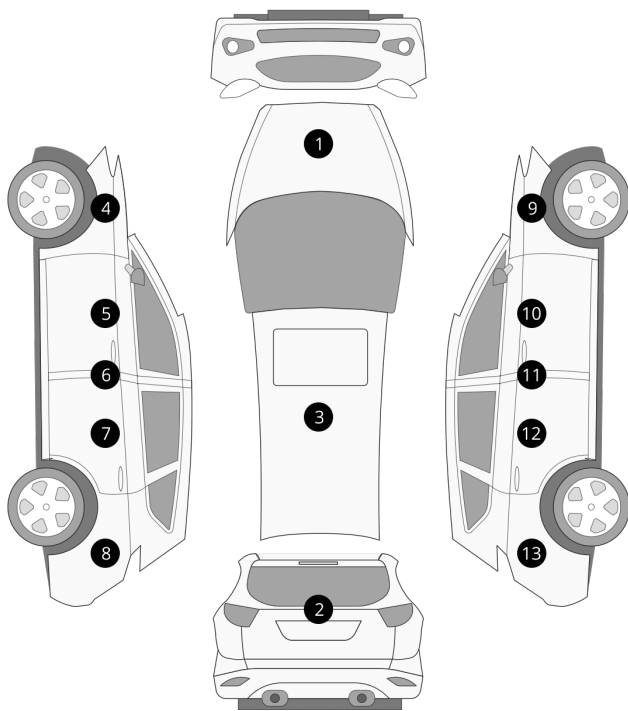


General Information

Date & Time: 06, Jul, 2026 15:56

Make	Subaru	Model	Forester
YOM	2015	Odo Meter Reading	96,715
Registration No.	ABT1423	Chassis No.	JF1SJ5LC5EG148752
CC	2.0	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Black		

Body / Panel Condition



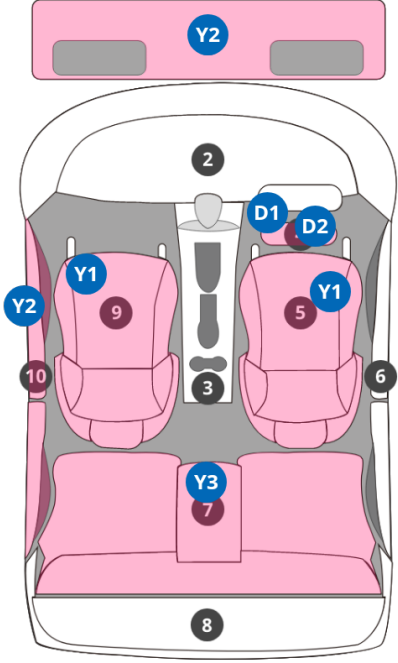
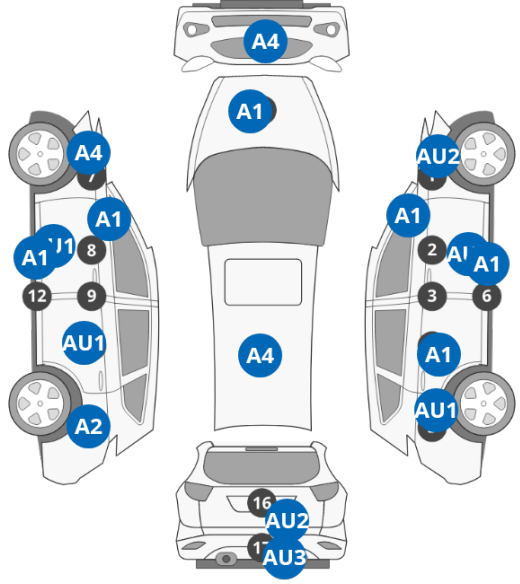
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	289.3	262	322	284
2	Boot Lid	173.6	187	156	178
3	Roof	117.4	84	105	164/117
4	Left Front Fender	378.3	404	393	338
5	Left Front Door	175.0	173	164	188
6	Center Panel Left				
7	Left Rear Door	174.6	178	148	198
8	Left Back Panel	192.6	216	188	174
9	Right Front Fender	518.6	363	439	754
10	Right Front Door	155.6	143	149	175
11	Center Panel Right				
12	Right Rear Door	178.6	169	165	202
13	Right Back Panel	186.6	176	173	211

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Carpet - Worked - Minimal / (L) Front Seat - Grime - Minimal	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Roof - Scratch - Large / (L) Front Fender, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights,