

General Information

Date & Time: 11, Jul, 2026 16:58

Make	Mitsubishi	Model	Mirage
YOM	2023	Odo Meter Reading	48,616
Registration No.	MAS5261	Chassis No.	PAEA13T2PNA000287
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



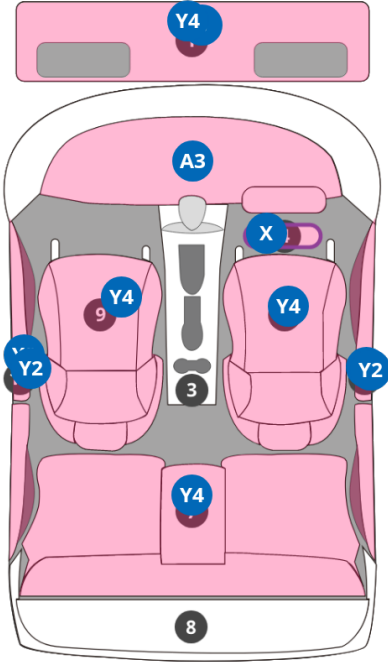
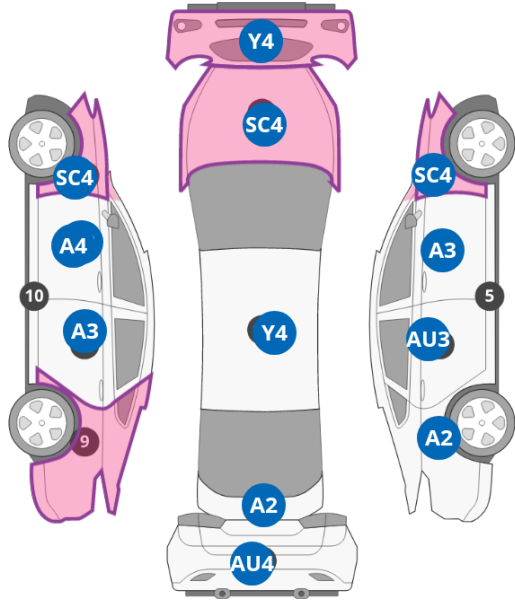
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	173.0	119	224	176
2	Boot Lid	124.0	113	124	135
3	Roof	117.5	128	130	108/104
4	Left Front Fender	122.6	123	123	122
5	Left Front Door	119.0	128	113	116
6	Center Panel Left				
7	Left Rear Door	110.0	111	110	109
8	Left Back Panel	135.6	138	134	135
9	Right Front Fender	222.0	243	220	203
10	Right Front Door	118.6	117	118	121
11	Center Panel Right				
12	Right Rear Door	117.6	117	114	122
13	Right Back Panel	135.6	132	136	139

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Ceiling - Grime - Large / (R) Front Floor Mat - Missing - Yes / Dashboard - Worn, Scratch, Cut, Crack - Medium / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Large / Rear Seat - Grime - Large / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (L) Rear Trim - Grime - Small / (R) Rear Trim - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (R) Front Fender, Molding - Partially Missing - Yes / (R) Front Fender, Molding - Repair mark - Difference in Color / (R) Front Fender, Molding - Rust, Corrosion - Large / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Repair mark - Difference in Color / (L) Front Fender, Molding - Rust, Corrosion - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Partially Missing - Yes / Front Bumper, Grille, Lamps - Repair mark - Difference in Color / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Repair mark - Difference in Color / Bonnet, Headlight - Rust, Corrosion - Large / Front Windshield - Damaged - Large / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large
Frame Evaluation : C	Functional Evaluation : C
Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes	Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate, no warranty booklet, incomplete tools, with jack, no seat cover, no spare key, with spare tire, no reverse camera, radio/device not functioning, front hazard lights not working, damaged bumper, repaired bumper/hood and fenders with repair marks, damaged windshield, front left no break pad, air-condition weak, with foul smell, possible flooded, no fuel cover.