

General Information

Date & Time: 11, Jul, 2026 08:16

Make	Mitsubishi	Model	Mirage
YOM	2019	Odo Meter Reading	116,469
Registration No.	NFT8665	Chassis No.	PAEA13TJCCA013052
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



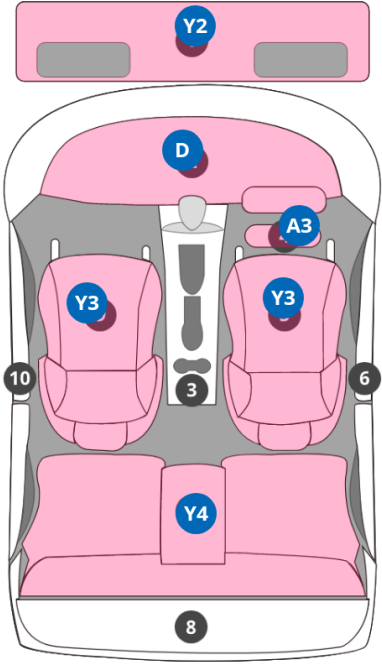
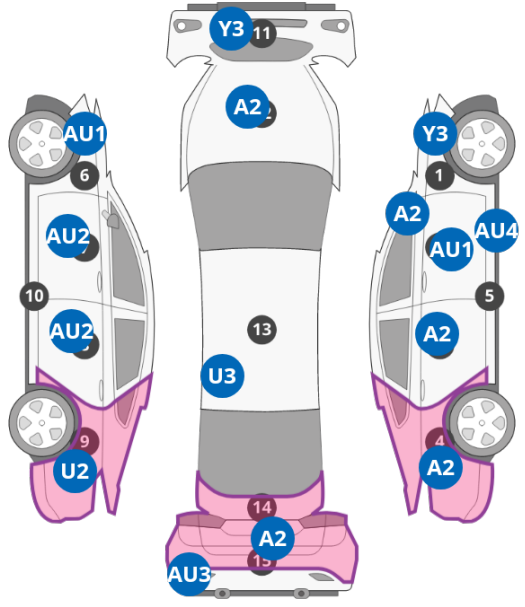
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	124	123	119
2	Boot Lid	166.0	158	122	218
3	Roof	103.2	99	102	106/106
4	Left Front Fender	112.6	109	106	123
5	Left Front Door	117.6	118	113	122
6	Center Panel Left				
7	Left Rear Door	121.6	126	115	124
8	Left Back Panel	162.3	143	175	169
9	Right Front Fender	272.0	210	412	194
10	Right Front Door	122.3	128	119	120
11	Center Panel Right				
12	Right Rear Door	120.0	127	115	118
13	Right Back Panel	124.3	120	117	136

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium / Rear Seat - Grime - Large / (R) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Dent - Small / Roof - Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (R) Front Fender, Molding - Crack, Gap - Medium / (R) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small
Frame Evaluation : B	Functional Evaluation : B
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Seat Belts - Issue - Yes

Inspector Notes
with LTO plate/with spare tire/with 1 spare key/No seat cover/headlight issue/No tools and incomplete tools/No reverse camera/with warranty booklet/unusual sound engine/cross member support traces of bending/No fog lights/plate light issue/