

General Information

Date & Time: 10, Jul, 2026 08:48

Make	Mitsubishi	Model	Mirage
YOM	2018	Odo Meter Reading	81,751
Registration No.	NDP3356	Chassis No.	PAEA13TJJJA006338
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



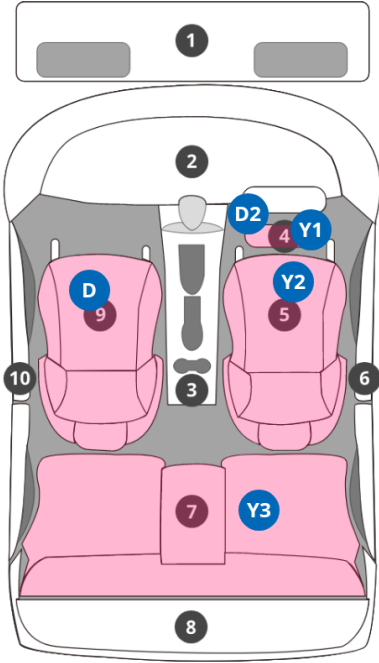
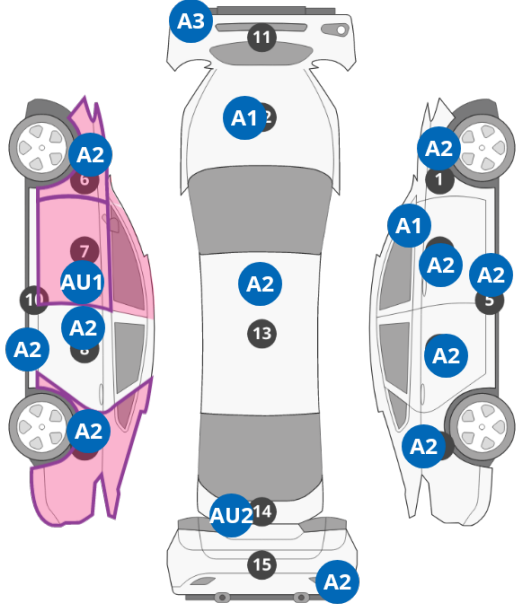
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.4	98	131	102
2	Boot Lid	118.3	125	116	114
3	Roof	97.9	98	101	97/97
4	Left Front Fender	214.3	220	222	201
5	Left Front Door	139.6	141	145	133
6	Center Panel Left				
7	Left Rear Door	116.3	134	110	105
8	Left Back Panel	142.3	144	136	147
9	Right Front Fender	116.3	127	109	113
10	Right Front Door	123.3	116	138	116
11	Center Panel Right				
12	Right Rear Door	113.3	111	106	123
13	Right Back Panel	121.6	117	116	132

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes / Overall Interior - Worn as per age - Yes	Remarks (L) Front Fender - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small / Overall Exterior - Worn as per age - Yes
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate/with warranty booklet/with tools no jack/with spare tire/maintenance warning lamp on/scratches on taillight and headlight cover/with spare key/hairline scratches on the body/sun visor mirror issue