

General Information

Date & Time: 10, Jul, 2026 18:32

Make	Nissan	Model	NV350
YOM	2018	Odo Meter Reading	120,644
Registration No.	NCM4520	Chassis No.	JN1TC2E26Z0016891
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Brown		

Body / Panel Condition



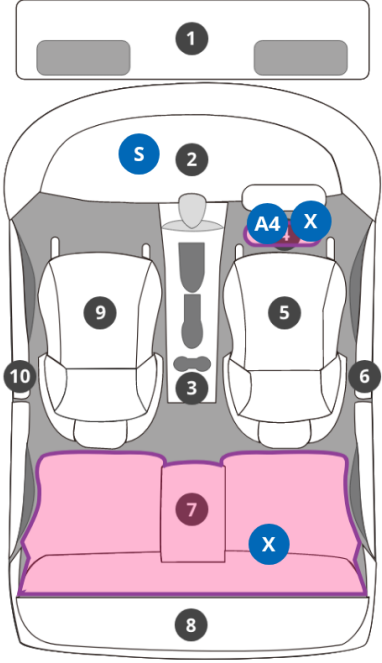
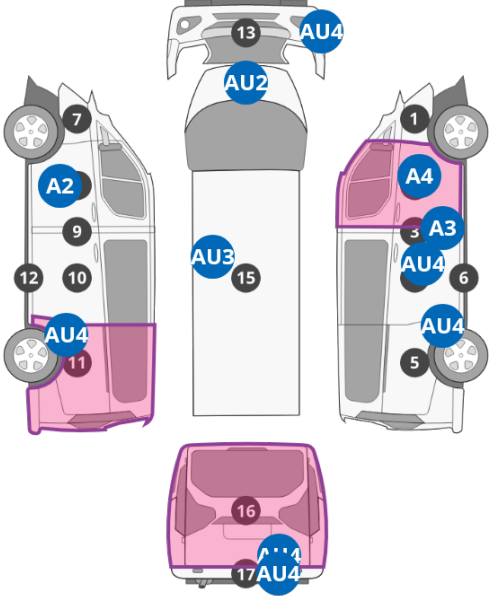
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	149	95	97
2	Boot Lid	197.0	99	256	236
3	Roof	101.1	84	102	104/114
4	Left Front Fender	94.6	103	93	88
5	Left Front Door	90.0	106	84	80
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	108.6	101	112	113
9	Right Front Fender	98.6	93	103	100
10	Right Front Door	108.9	121	109	97
11	Center Panel Right	99.5	109	99	90
12	Right Rear Door	117.0	111	119	121
13	Right Back Panel	124.3	114	129	130

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Mat Other - Missing - Yes / Rear Seat - Partially Missing - Yes / Carpet - Worn, Scratch, Cut, Crack - Large	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Large / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Center Panel - Scratch - Medium / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Front Panel - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / Roof - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

no tools/ possible flooding/ light scratches around the exterior/ tail light issue/ interior light issue/ fog light issue/ no warranty booklet/ with spare tire and jack/ with LTO plate