

General Information

Date & Time: 11, Jul, 2026 17:27

Make	Nissan	Model	Almera
YOM	2020	Odo Meter Reading	60,726
Registration No.	NAN2775	Chassis No.	BDUALBAN17C52252
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Brown		

Body / Panel Condition



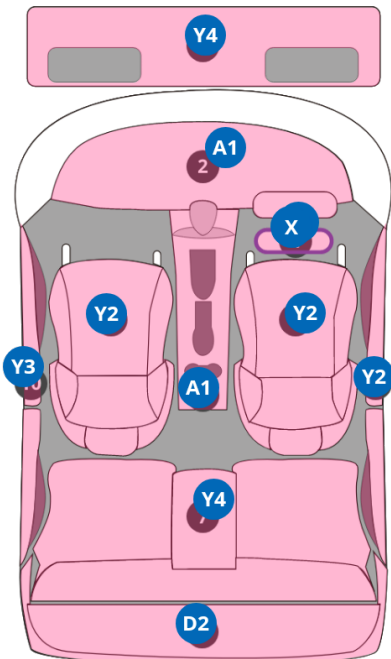
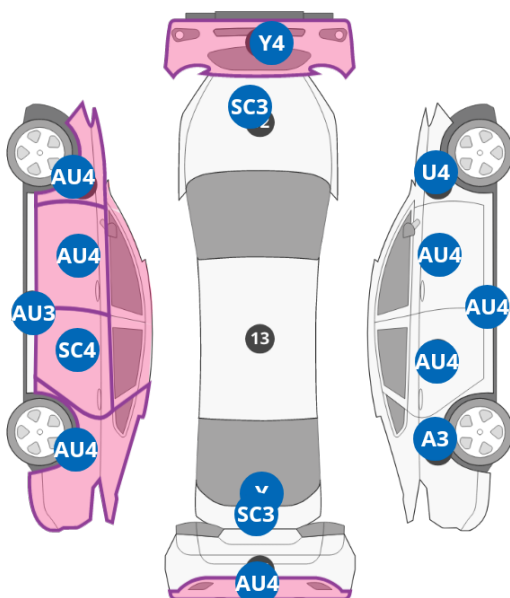
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	106	101	130
2	Boot Lid	78.6	85	71	80
3	Roof	79.0	87	90	69/69
4	Left Front Fender	110.3	117	104	110
5	Left Front Door	135.6	150	137	120
6	Center Panel Left				
7	Left Rear Door	870.3	1,183	991	437
8	Left Back Panel	796.0	904	827	657
9	Right Front Fender	96.3	82	101	106
10	Right Front Door	91.8	95	94	87
11	Center Panel Right				
12	Right Rear Door	88.7	85	81	100
13	Right Back Panel	76.4	71	77	81

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C		Exterior Evaluation : E	
			
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks Ceiling - Grime - Large / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Grime - Large / Trunk Room - Loose, Deformed - Small		Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Medium / Overall Exterior - Faded(Color, Gloss) - Yes / (L) Front Fender, Molding - Repair mark - Difference in Color / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Repair mark - Difference in Color / (L) Front Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Repair mark - Difference in Color / (L) Rear Door, Molding - Rust, Corrosion - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Fender, Molding - Repair mark - Difference in Color / (L) Rear Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Repair mark - Difference in Color / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Rust, Corrosion - Medium / Antennae - Damaged - Yes / Trunk Hood, Rear Gate - Rust, Corrosion - Medium / Rear Bumper, Lamps, Panels - Repair mark - Difference in Color / Rear Bumper, Lamps, Panels - Scratch & Dent - Large	
Frame Evaluation : A		Functional Evaluation : C	
Remarks Defects not found		Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist	

With LTO plate, no warranty booklet, no tools, no jack, no spare key, with seat cover, no reverse camera, with spare rim but separated to the tire, damaged rear and front bumpers, with repaired parts difference in color, air-condition weak, color faded, no floor mat, missing antenna.