

General Information

Date & Time: 16, Jul, 2026 14:01

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	104,591
Registration No.	CBE8177	Chassis No.	PA1B18F32N4197229
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



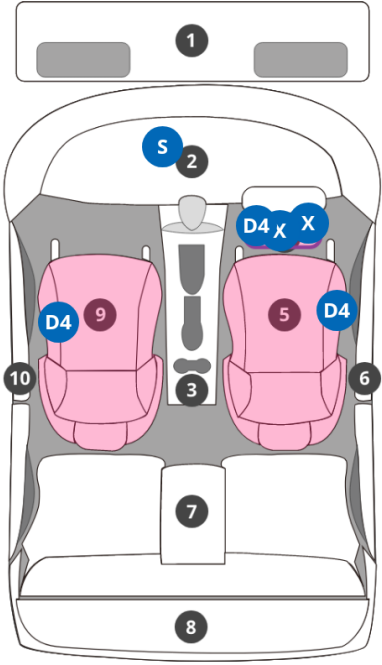
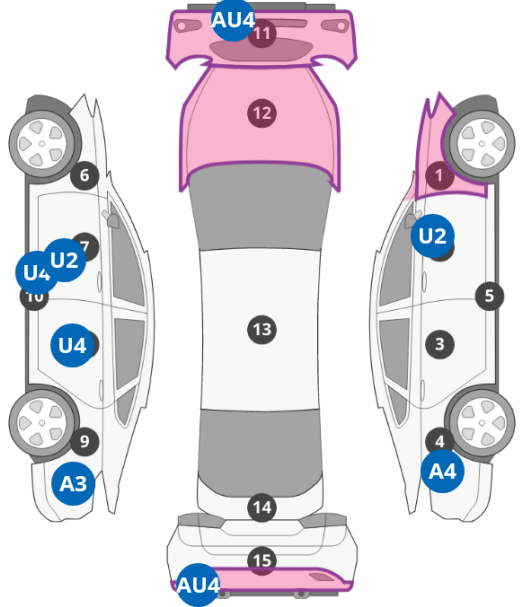
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	199.3	136	246	216
2	Boot Lid	132.3	122	145	130
3	Roof	100.2	102	98	98/103
4	Left Front Fender	100.6	104	98	100
5	Left Front Door	197.6	175	260	158
6	Center Panel Left				
7	Left Rear Door	173.3	224	150	146
8	Left Back Panel	193.0	196	244	139
9	Right Front Fender	101.0	103	100	100
10	Right Front Door	105.0	106	102	107
11	Center Panel Right				
12	Right Rear Door	97.1	96	92	103
13	Right Back Panel	102.5	99	99	109

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Floor Mat - Worked - Large / Overall Interior - Smell - Yes / (R) Front Seat belt - Loose, Deformed - Large / (L) Front Seat belt - Loose, Deformed - Large	Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Rear Door, Molding - Dent - Large / (L) Step, In-panel, Side Spoiler - Dent - Large / (L) Front Door, Molding - Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Front Door, Molding - Dent - Small / (R) Front Fender, Molding - Partially Missing - Yes / Bonnet, Headlight - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

non moving vehicle/ seatbelt issue/ instrument panel issue/ horn issue /head light and tail light issue/ turn signal issue/ radio issue/ air-conditioning issue/ power window issue/ possible flooding/ no warranty booklet/ no tools and jack/ no spare tire/ no LTO plate/ light scratches around the exterior/