

General Information

Date & Time: 13, Jul, 2026 19:09

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	13,838
Registration No.	NKP5144	Chassis No.	PAHACACA9S6422313
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



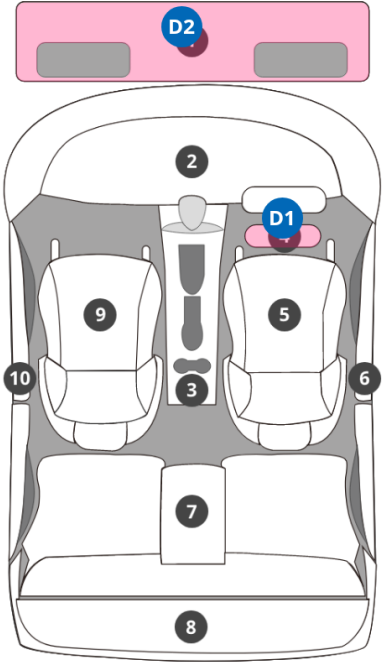
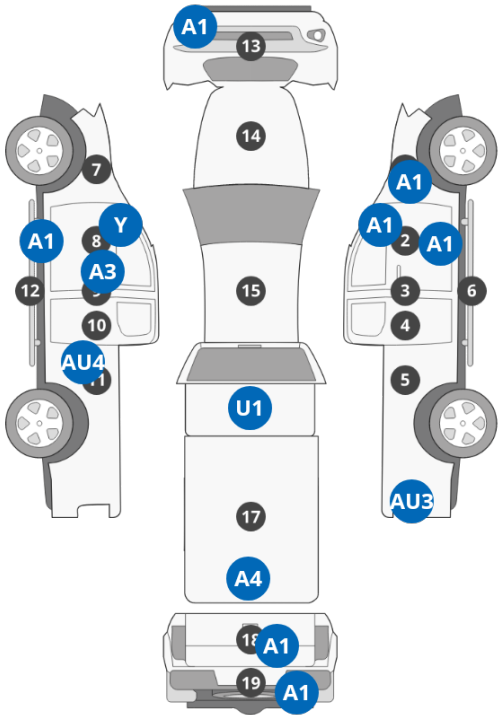
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.2	101	102	98
2	Boot Lid	57.0	51	49	71
3	Roof	109.2	115	114	102/106
4	Left Front Fender	107.0	109	102	110
5	Left Front Door	100.4	99	101	101
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	65.8	63	73	62
9	Right Front Fender	101.8	112	103	91
10	Right Front Door	102.0	100	105	101
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	51.1	53	48	53

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Carpet - Worked - Minimal / Ceiling - Loose, Deformed - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Medium / Cargo Bed Floor - Scratch - Large / Rear Gate - Scratch - Minimal / (L) Side Gate - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Crack - Damaged / Roof - Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes

Inspector Notes

With Lto plate, with spare tire and jack, with warranty booklet, 2keys, fuel lid issue