

General Information

Date & Time: 15, Jul, 2026 15:41

Make	Toyota	Model	Avanza
YOM	2026	Odo Meter Reading	10,148
Registration No.	DCE5725	Chassis No.	MHFAA1BY5S0055738
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Black		

Body / Panel Condition



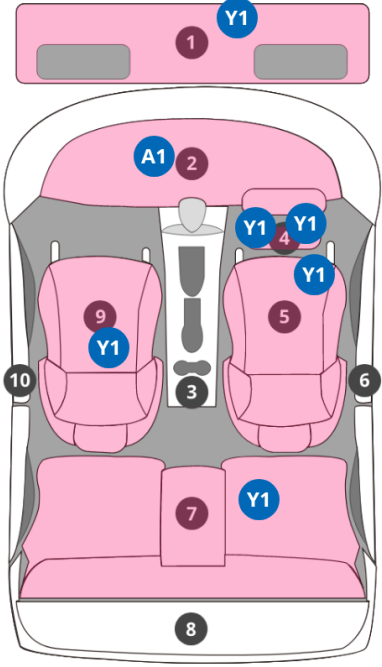
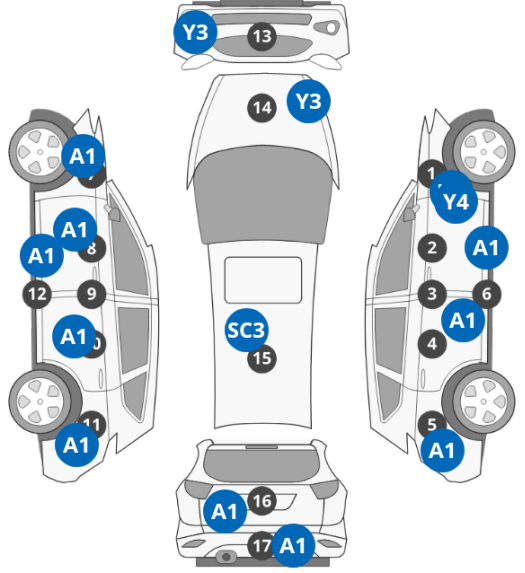
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	112	117	119
2	Boot Lid	107.6	106	105	112
3	Roof	117.2	124	121	108/116
4	Left Front Fender	106.3	113	102	104
5	Left Front Door	124.6	121	122	131
6	Center Panel Left				
7	Left Rear Door	116.6	117	109	124
8	Left Back Panel	123.0	131	110	128
9	Right Front Fender	105.7	111	108	98
10	Right Front Door	117.6	127	115	111
11	Center Panel Right				
12	Right Rear Door	115.3	112	108	126
13	Right Back Panel	122.6	113	119	136

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Worn, Scratch, Cut, Crack - Minimal / (L) Front Floor Mat - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / Rear Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Ceiling - Grime - Minimal	Remarks (R) Front Fender, Molding - Dent - Large / (R) Front Door, Molding - Crack, Gap - Large / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Crack, Gap - Medium / Roof - Rust, Corrosion - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with Ito plate/with warranty booklet/with spare tire/with spare key/with hairlines scratches on the body/with reverse camera/unusual noise while opening front passenger door/dent in right side headlight bracket