

General Information

Date & Time: 16, Jul, 2026 15:47

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	32,690
Registration No.	NJA9956	Chassis No.	MHFAA1BY7S0039542
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



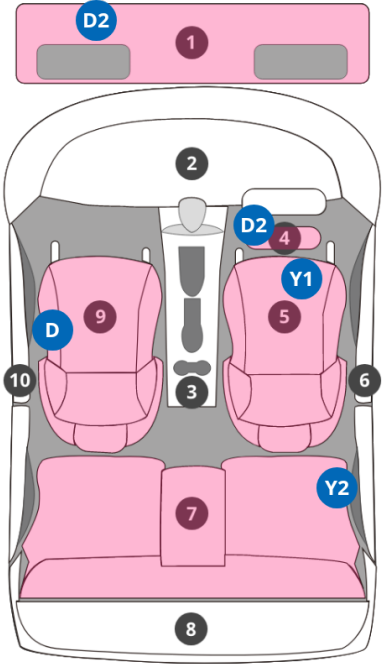
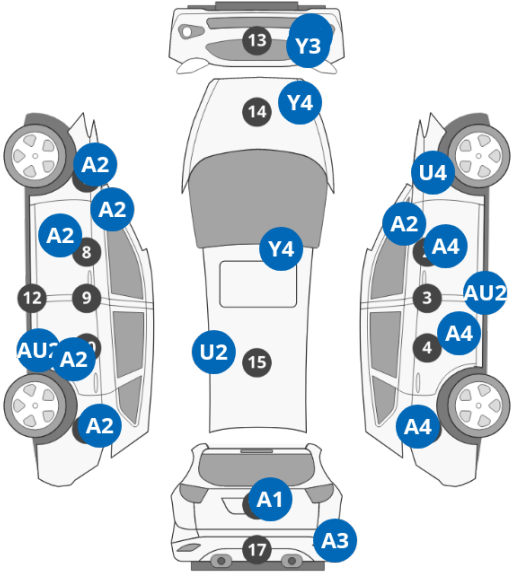
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	185.0	223	165	167
2	Boot Lid	119.0	131	107	119
3	Roof	129.5	140	131	108/139
4	Left Front Fender	104.0	109	100	103
5	Left Front Door	119.0	110	124	123
6	Center Panel Left				
7	Left Rear Door	117.6	121	111	121
8	Left Back Panel	122.6	128	119	121
9	Right Front Fender	304.0	183	530	199
10	Right Front Door	332.3	568	197	232
11	Center Panel Right				
12	Right Rear Door	114.0	118	110	114
13	Right Back Panel	113.6	112	113	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Worked - Small / Ceiling - Crinkle - Small / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Modified - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Crack, Gap - Large / Front Windshield - Damaged - Large / Roof - Dent - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, no jack and tools, no spare tire, with LTO plate, scratches on tail light, fog lamps issue