

General Information

Date & Time: 22, Jul, 2026 15:37

Make	Toyota	Model	Avanza
YOM	2023	Odo Meter Reading	73,419
Registration No.	DBH7105	Chassis No.	MHFAA1BYXP0013962
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Red		

Body / Panel Condition



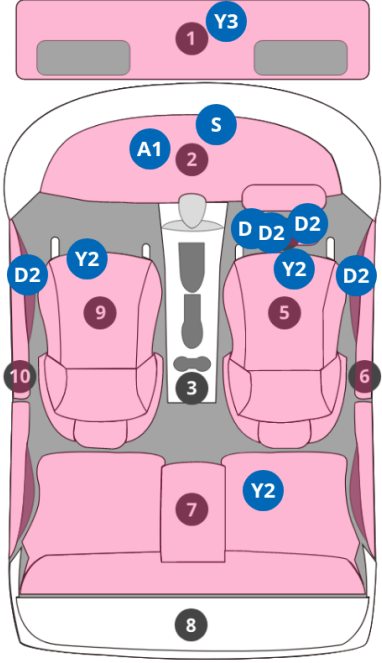
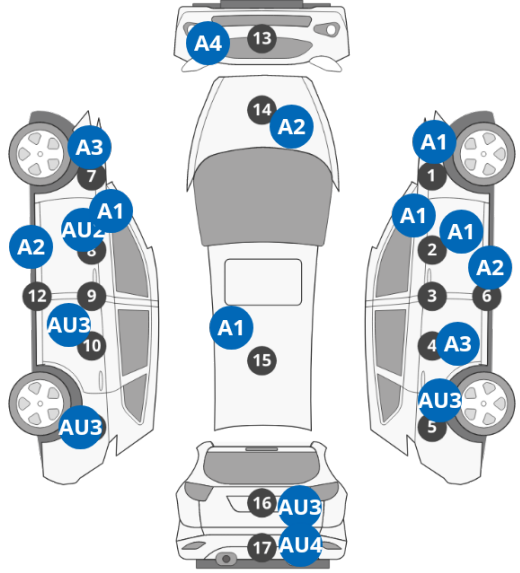
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.3	122	105	116
2	Boot Lid	106.3	102	115	102
3	Roof	111.2	120	114	98/113
4	Left Front Fender	106.6	106	103	111
5	Left Front Door	118.6	114	118	124
6	Center Panel Left				
7	Left Rear Door	121.6	119	110	136
8	Left Back Panel	120.3	118	113	130
9	Right Front Fender	106.6	115	104	101
10	Right Front Door	117.6	119	119	115
11	Center Panel Right				
12	Right Rear Door	121.3	125	119	120
13	Right Back Panel	122.3	129	111	127

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Mat Other - Worked - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Ceiling - Grime - Medium / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small	Remarks Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal / (L) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Remote Key & Smart entry - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/without warranty booklet/with spare tire/with dent and hairlines scratches on the body/with reverse camera/with rust on rear door/with plate light issue/with dome light issue/possible flooded/key remote buttons issue/glovebox missing