

General Information

Date & Time: 20, Jul, 2026 15:49

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	68,865
Registration No.	NFR7324	Chassis No.	PA2JA8EM9R0141464
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



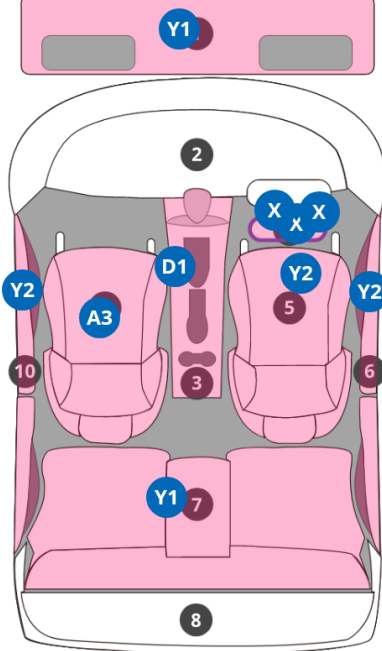
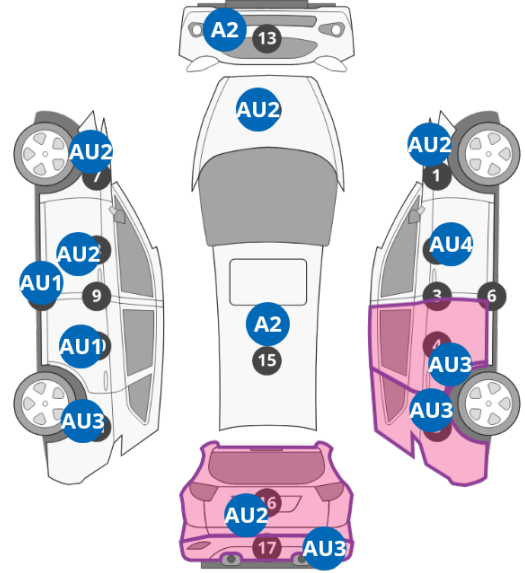
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.8	106	127	99
2	Boot Lid	210.6	176	306	150
3	Roof	103.2	109	104	102/98
4	Left Front Fender	102.0	93	109	104
5	Left Front Door	105.3	106	103	107
6	Center Panel Left				
7	Left Rear Door	113.3	120	112	108
8	Left Back Panel	118.6	117	119	120
9	Right Front Fender	108.6	112	108	106
10	Right Front Door	115.0	116	109	120
11	Center Panel Right				
12	Right Rear Door	110.3	106	107	118
13	Right Back Panel	120.6	122	117	123

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Cut, Crack - Medium / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Minimal / Console, Switchs, Vents - Worked - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Head Light, High Beam - Issue - Yes

Inspector Notes
with LTO plate, with spare tire and key, with reverse camera, with manual and warranty booklet, no tools and jack, scratches and dent on exterior, scratches in taillight and headlight.