

General Information

Date & Time: 25, Jul, 2026 15:58

Make	Toyota	Model	Lite Ace
YOM	2023	Odo Meter Reading	44,309
Registration No.	NHJ8027	Chassis No.	MHKU3FE10PK004001
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



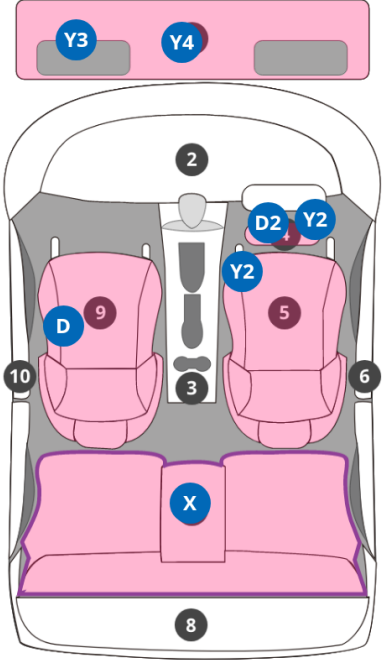
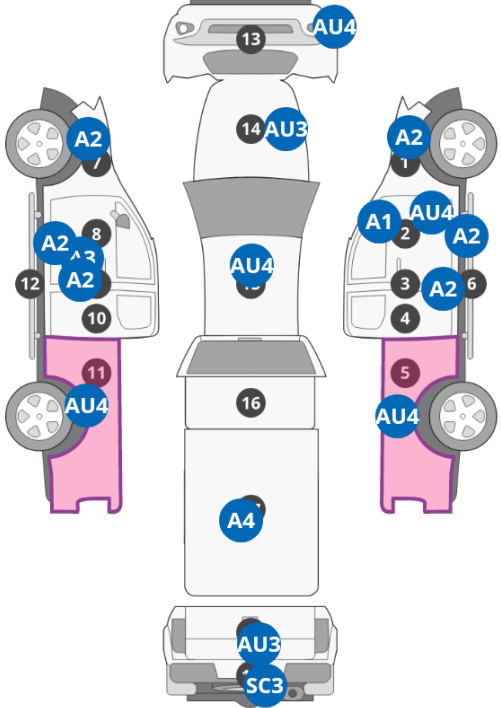
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	65.1	67	65	64
2	Boot Lid	131.6	126	136	133
3	Roof	45.4	41	50	43/47
4	Left Front Fender	54.2	54	51	59
5	Left Front Door	59.6	63	59	58
6	Center Panel Left	67.1	72	63	66
7	Left Rear Door				
8	Left Back Panel	709.0	345	524	1,258
9	Right Front Fender	64.3	74	62	57
10	Right Front Door	58.6	56	57	63
11	Center Panel Right	62.9	69	50	70
12	Right Rear Door				
13	Right Back Panel	590.0	1,114	529	127

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Missing - Yes / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Large / Sunvisor, Sunglass Holder - Grime - Medium	Remarks (R) Front Door - Repair Traces - Yes / Front Panel - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Corner Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Side Gate - Repair mark - Yes / (L) Side Gate - Repair mark - Yes / (R) Side Gate - Scratch & Dent - Large / (R) Center Panel - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Front Panel - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Center Panel - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Rust, Corrosion - Medium / Cargo Bed Floor - Scratch - Large / Rear Gate - Scratch & Dent - Medium / Roof - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/no warranty booklet/no tools with jack/with spare tire/no spare key/shift knob missing/scratches on taillight and headlight cover/rear cab glass issue/rear seats missing/rear windows issue/traces of adhesive on exterior and interior/cab side window issue/rear room light issue/hairline scratches on the body