

General Information

Date & Time: 14, Jul, 2026 20:10

Make	Mitsubishi	Model	Mirage
YOM	2024	Odo Meter Reading	32,146
Registration No.	LAO5122	Chassis No.	PAEA03RGRRRA008082
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



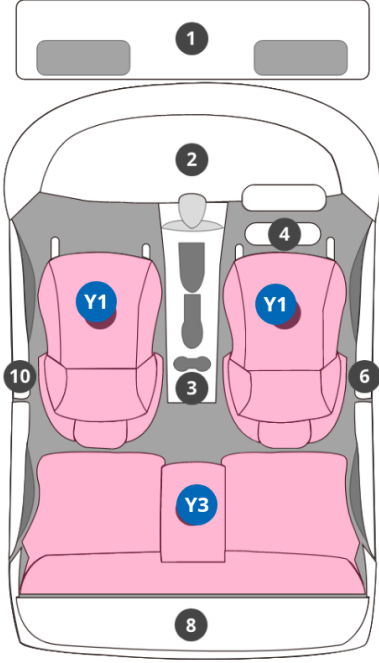
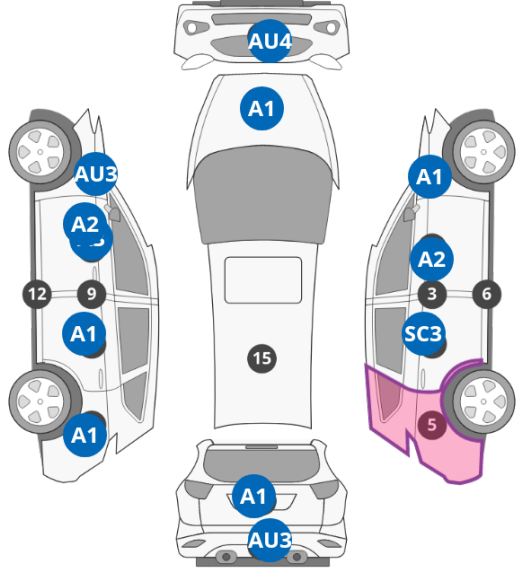
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	132.6	135	139	124
2	Boot Lid	116.0	123	114	111
3	Roof	121.2	120	108	129/128
4	Left Front Fender	101.6	118	97	90
5	Left Front Door	109.3	108	109	111
6	Center Panel Left				
7	Left Rear Door	111.0	116	114	103
8	Left Back Panel	116.3	109	117	123
9	Right Front Fender	101.0	95	100	108
10	Right Front Door	101.6	102	100	103
11	Center Panel Right				
12	Right Rear Door	128.3	129	127	129
13	Right Back Panel	172.6	147	151	220

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Medium	Remarks (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Rust, Corrosion - Medium / (R) Rear Fender, Molding - Repair mark - Difference in Color / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Mirror - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate, no warranty booklet, no tools, no jack, no seat cover, no spare key, with spare tire, with hairline scratches, no reverse camera.