

General Information

Date & Time: 15, Jul, 2026 15:11

Make	Mitsubishi Fuso	Model	Canter
YOM	2019	Odo Meter Reading	187,267
Registration No.	DAZ4960	Chassis No.	JL6J2B6T9KK002145
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	FB Body
Colour	White		

Body / Panel Condition



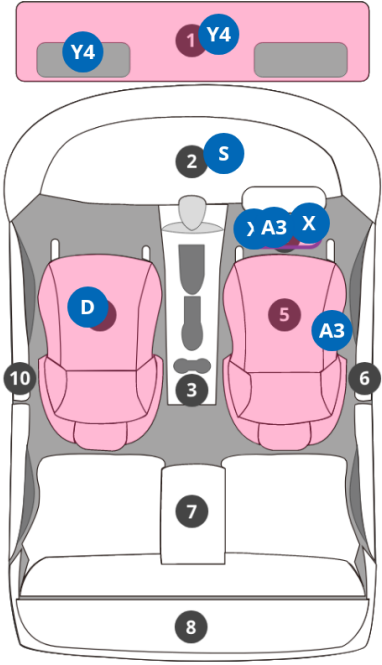
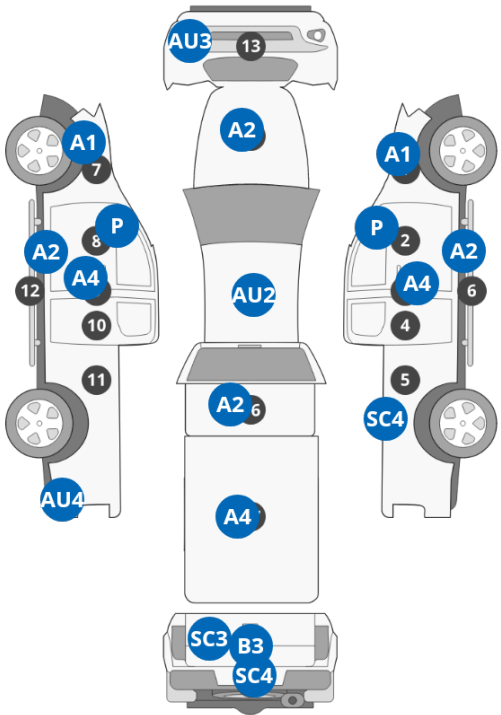
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	81.7	81	79	85
2	Boot Lid	1,172.0	1,219	1,024	1,273
3	Roof	96.3	98	101	93/94
4	Left Front Fender	82.3	88	79	81
5	Left Front Door	83.1	90	78	82
6	Center Panel Left	85.4	87	82	87
7	Left Rear Door				
8	Left Back Panel	716.6	481	570	1,099
9	Right Front Fender	77.8	73	89	72
10	Right Front Door	81.1	73	84	86
11	Center Panel Right	75.8	76	77	75
12	Right Rear Door				
13	Right Back Panel	163.3	201	161	128

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Cut, Crack - Medium / (L) Front Seat - Worn - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Carpet - Worn, Scratch, Cut, Crack - Medium / Sunvisor, Sunglass Holder - Grime - Large / Ceiling - Grime - Large / Overall Interior - Smell - Yes	Remarks (R) Front Door - Repair Traces - Yes / Front Panel - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Corner Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / Cargo Bed Floor - Scratch - Large / Rear Bumper, Lamps, Panels - Rust, Corrosion - Large / Rear Gate - Modified - Medium / Rear Gate - Rust, Corrosion - Medium / (L) Side Gate - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Faded(Color, Gloss) - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Panel - Scratch - Small / (R) Mirror - Faded(Color, Gloss) - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Side Gate - Rust, Corrosion - Large / Cab Back Panel - Scratch - Small / Roof - Scratch & Dent - Small / Overall Exterior - Faded(Color, Gloss) - Yes
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Brake Pedal - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes

Inspector Notes
with LTO plate/no warranty booklet/no tools and jack/with spare tire/with spare key/aircon issue/tailight issue/tailight cover cracked/no horn/clutch issue/rear headlining missing/rear windows issue and scratches/rear door issue/ plate light issue/brake pedal weak/brake light issue/wiper blade issue/hairline scratches on the body/rear room light issue/frame rust and corrosion unseen