

General Information

Date & Time: 15, Jul, 2026 17:09

Make	Mitsubishi	Model	Xpander
YOM	2019	Odo Meter Reading	85,854
Registration No.	NDP9291	Chassis No.	MK2XRNC1WKN027530
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



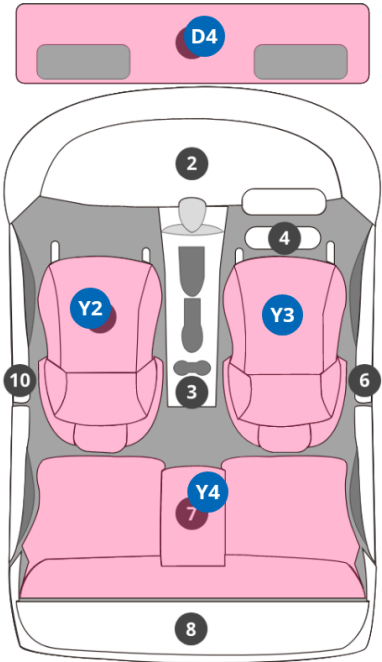
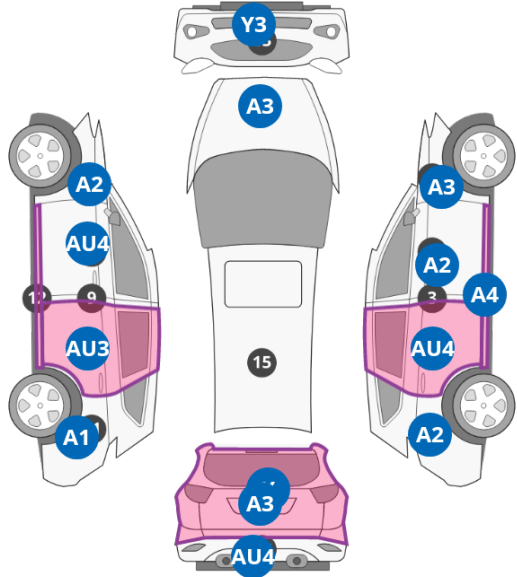
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	109	105	113
2	Boot Lid	605.3	120	925	771
3	Roof	123.0	130	120	121/121
4	Left Front Fender	161.3	175	159	150
5	Left Front Door	111.0	112	106	115
6	Center Panel Left				
7	Left Rear Door	421.6	208	217	840
8	Left Back Panel	916.3	754	1,265	730
9	Right Front Fender	110.6	116	115	101
10	Right Front Door	118.6	120	116	120
11	Center Panel Right				
12	Right Rear Door	225.0	222	231	222
13	Right Back Panel	134.0	121	124	157

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Crinkle - Large / Rear Seat - Grime - Large / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Repair mark - Difference in Color / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Step, In-panel, Side Spoiler - Repair mark - Difference in Color / (R) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Repair mark - Difference in Color / (L) Rear Door, Molding - Scratch & Dent - Medium / Overall Exterior - Re-Paint Uneven - Yes / (L) Rear Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Repair mark - Difference in Color / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Medium / Antennae - Damaged - Yes / Trunk Hood, Rear Gate - Repair mark - Difference in Color / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate, with warranty booklet, with tools, with jack, no seat cover, with hairline scratches, no spare key, with spare tire, right side mirror not functioning, repaired rear right and left door (difference in color), faded color, some areas are repainted.