


General Information

Date & Time: 15, Jul, 2026 16:59

Make	Suzuki	Model	Dzire
YOM	2023	Odo Meter Reading	40,168
Registration No.	NGC3464	Chassis No.	MBHZF63S0PG233166
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition

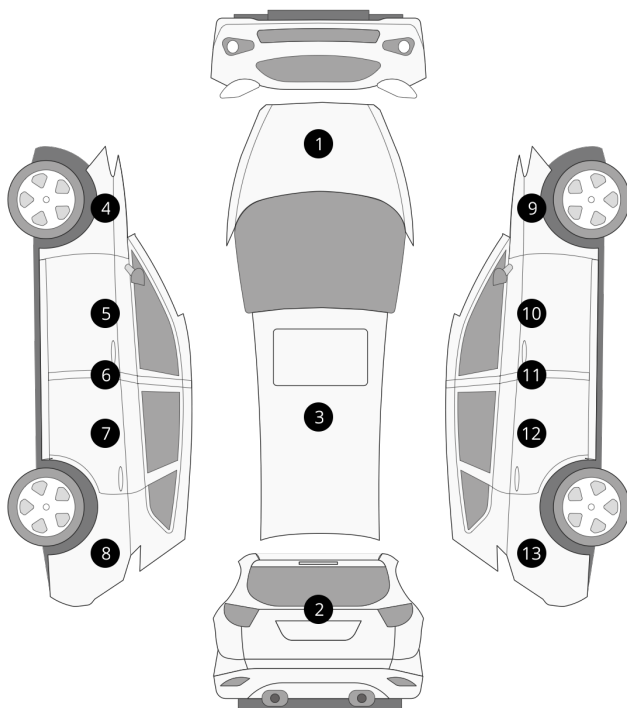

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	89.7	84	86	99
2	Boot Lid	64.8	63	63	69
3	Roof	99.5	68	111	109/110
4	Left Front Fender	86.0	94	80	84
5	Left Front Door	152.3	152	153	152
6	Center Panel Left				
7	Left Rear Door	83.5	87	80	84
8	Left Back Panel	95.5	93	99	95
9	Right Front Fender	626.6	202	606	1,072
10	Right Front Door	148.3	141	143	161
11	Center Panel Right				
12	Right Rear Door	139.3	132	132	154
13	Right Back Panel	172.6	163	171	184

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Medium / Rear Seat - Grime - Large / (R) Front Trim - Grime - Medium / Ceiling - Crinkle - Medium	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Rust, Corrosion - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Minimal / Antennae - Damaged - Yes / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Window (each) - Stuck, Gap - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate, no warranty booklet, no tools, with jack, no spare key, with spare tire, with seat cover, no reverse camera, front right window not functioning , with hairline scratches, with unusual engine sound.