

General Information

Date & Time: 16, Jul, 2026 14:02

Make	Honda	Model	Civic
YOM	2018	Odo Meter Reading	65,762
Registration No.	NAM7145	Chassis No.	MRHFC6S30JT020285
CC	1.8	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



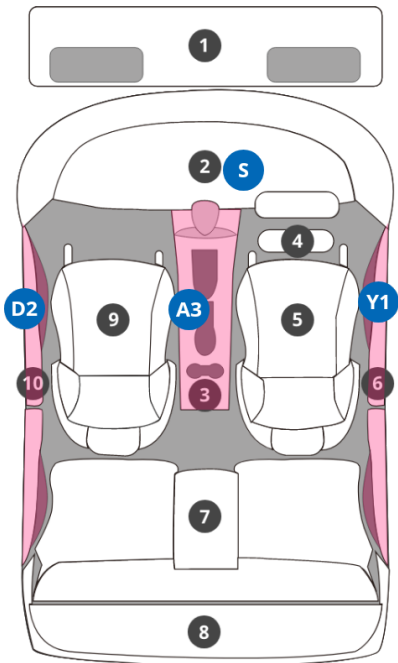
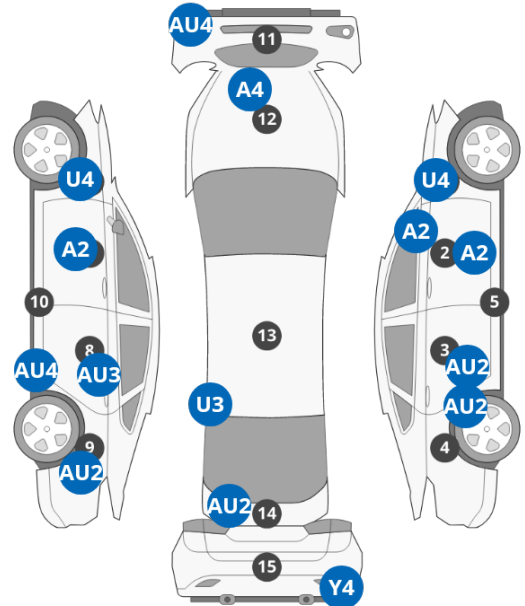
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.0	130	112	115
2	Boot Lid	115.3	120	118	108
3	Roof	201.2	156	295	169/185
4	Left Front Fender	274.3	177	180	466
5	Left Front Door	239.0	217	311	189
6	Center Panel Left				
7	Left Rear Door	210.0	304	173	153
8	Left Back Panel	98.2	95	92	108
9	Right Front Fender	284.6	127	142	585
10	Right Front Door	121.3	124	116	124
11	Center Panel Right				
12	Right Rear Door	116.3	118	112	119
13	Right Back Panel	445.6	195	1,006	136

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / (L) Front Trim - Crinkle - Small / (R) Front Trim - Grime - Minimal / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Large / (L) Front Fender, Molding - Dent - Large / (L) Front Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / Roof - Dent - Medium
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Power Window (each) - Stuck, Gap - Yes / Air Conditioner - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
air-conditioning system issue/ power window issue/ possible flooding/ light scratches around the exterior/ with jack and spare tire/ with tools/ with LTO plate and warranty booklet/