

General Information

Date & Time: 20, Jul, 2026 15:41

Make	Toyota	Model	Hilux
YOM	2024	Odo Meter Reading	26,530
Registration No.	NHS1002	Chassis No.	MR0JB8DD1P3548089
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Black		

Body / Panel Condition



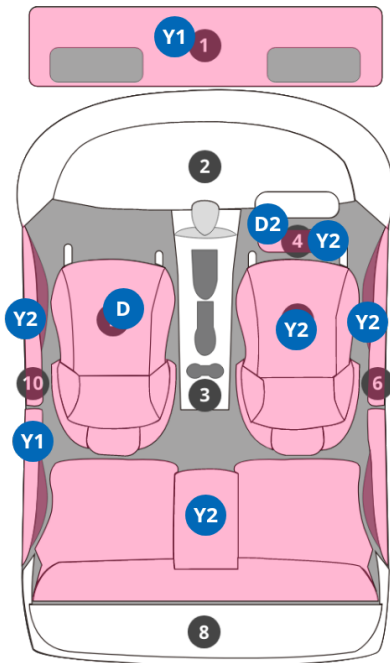
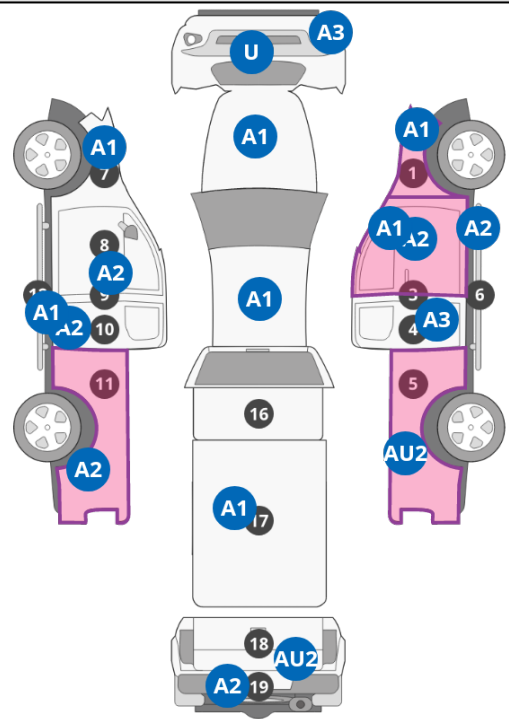
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.3	123	124	123
2	Boot Lid	105.0	111	100	104
3	Roof	110.2	109	100	116/116
4	Left Front Fender	120.0	135	114	111
5	Left Front Door	121.6	122	121	122
6	Center Panel Left				
7	Left Rear Door	107.6	110	106	107
8	Left Back Panel	248.3	134	177	434
9	Right Front Fender	153.6	168	157	136
10	Right Front Door	146.6	145	151	144
11	Center Panel Right				
12	Right Rear Door	102.8	102	100	107
13	Right Back Panel	166.3	156	171	172

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal	Remarks (L) Rear Corner Panel - Repair Traces - Yes / (L) Side Gate - Repair mark - Yes / (R) Side Gate - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Side Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Side Gate - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Cargo Bed Floor - Scratch - Minimal / Roof - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Rear Gate - Scratch & Dent - Small / Member (Bolted) - Dent - Yes
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Shift Shock - Function - Weak / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate rear not installed/no warranty booklet/with tools no jack/no spare tire/scratches on headlight and taillight cover/no spare key/hairline scratches on the body/shift shock