

General Information

Date & Time: 20, Jul, 2026 15:09

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	10,325
Registration No.	NJC2494	Chassis No.	MHFAA1BY7S0040853
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



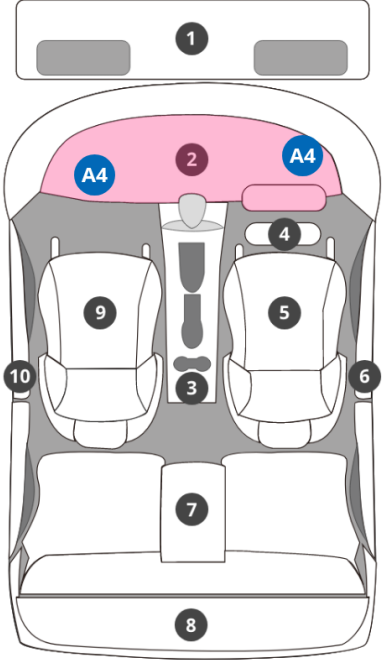
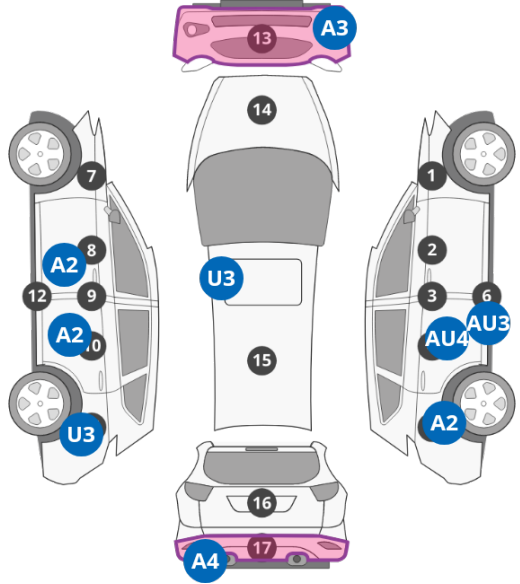
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	110	111	113
2	Boot Lid	111.0	117	117	99
3	Roof	115.7	121	126	105/111
4	Left Front Fender	104.3	108	101	104
5	Left Front Door	121.6	115	118	132
6	Center Panel Left				
7	Left Rear Door	115.3	115	110	121
8	Left Back Panel	118.6	125	123	108
9	Right Front Fender	105.2	109	108	99
10	Right Front Door	114.3	118	112	113
11	Center Panel Right				
12	Right Rear Door	117.3	117	114	121
13	Right Back Panel	109.0	105	105	117

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Steering Wheel - Worn, Peel, Crack - Large / Dashboard - Worn, Scratch, Cut, Crack - Large	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Dent - Medium / (L) Rear Fender, Molding - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Difference in Color / Rear Bumper, Lamps, Panels - Repair mark - Difference in Color
Frame Evaluation : D	Functional Evaluation : D
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Center Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Power Steering - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
airbag issue/ airbag warning light on/ power steering issue/ power steering warning light on// no jack and tools/ no warranty booklet/ seat belt issue/ possible flooding/light scratches around the exterior/ with LTO plate